Nokia Customer Care
RH-29 Series Cellular Phones

6a - Baseband Troubleshooting

Copyright © 2004 Nokia Corporation
Company Confidential

Table of Contents

Page No

Introduction to RH-29 Troubleshooting 3
General guidelines for RH-29 troubleshooting 3
Tools needed for troubleshooting 3
General guidelines 3
Nominal current consumption 4
Troubleshooting Paths 5
Dead or jammed device 5
Partially damaged device 6
Most common symptoms reported by customer 6
Most common symptoms for audio problems 6
Symptoms related to energy management 6
Problems related to UI module: 6
Most common RF related symptoms: 6
ASIC is changed 7
UEM changed 7
UPP_WD2 changed 7
ZOCUS changed 7
Test points 7
"CONTACT SERVICE" on display 8
1CK Baseband HW Subarea Troubleshooting 9
Flashing troubleshooting 9
Energy management troubleshooting 11
Device does not stay on 11
General power checking 12
Power key troubleshooting 14
Clocks troubleshooting 14
Charging checking 16
Energy management calibration 19
ADC-reading 20
Backup battery 21
SIM card 22
Memory troubleshooting 26
Serial interface troubleshooting 27
CBUS 27
FBUS 28
MBUS 28
MMC troubleshooting 29
Vibra 30
ZOCUS 31
UI Module Troubleshooting 32
Keymat backlight 32
Keyboard problem 33
Display blank 34
Image on display not correct 35
Backlight does not turn on 36
Handportable audio 37
Accessory Audio 40

Copyright © 2004 Nokia Corporation
Company Confidential

Introduction to RH-29 Troubleshooting

This document is intend to be a guide for localizing and repairing electrical faults in the RH-29 device. First there is a brief guide for fault localizing. Then fault repairing is divided into troubleshooting paths.

Before any service operation you must be familiar with the RH-29 product and module level architecture. You have to also be familiar with the RH-29 specified service tools such as the Phoenix service software, flashing tools and software.

General guidelines for RH-29 troubleshooting

Tools needed for troubleshooting

- Service tools (as listed at service tools chapter in service manual)
- Laboratory power supply with current indicator
- Oscilloscope
- Digital multimeter

General guidelines

If the device cannot be turned on by any means, see "dead device" troubleshooting

Current consumption (missing consumption) gives an idea whether the device is able to start up.

Dropping supply voltage or very large current consumption indicates a short circuit

Check whether the connection with Phoenix works and what can be discovered with Phoenix (ADC-readings, baseband self-test, BB-calibrations etc.)

Check baseband self-tests with Phoenix if "CONTACT SERVICE" is shown on the display.

Check visually display and rocker faults.

Force phone to LOCAL mode and make keyboard test by phoenix.

Check that board-to-board connector is OK, and connectors make good contacts.

If liquid damage, stop repairing!

Flash the phone before disassembling it, if the fault is not obvious and the Phoenix connection is OK.

Disassemble phone:

Try to locate failed module.

Copyright © 2004 Nokia Corporation
Company Confidential

Check failed module visually:

Mechanical damages?

Solder joints OK?

Continue with specific troubleshooting procedure for the module:

If there is an obvious fault, repair it before reflashing the device.

Flash first if a fault is not obvious.

If flashing is not working go to flashing troubleshooting.

Due to CSP packages short circuits or broken solder joints are not easily seen. If the examined signal seems to be continuously in low or high level, then measure for possible short circuit to ground (signal low) or to supply voltage (signal high) Note that if a problem is not found from any visible contact/component it can be under CSPs where the signal is connected.

Care must be taken when assembling and disassembling the transceiver. Failure to do this may result in unnecessary damage to device.

Nominal current consumption

NOTE: Service tools need some amount of current to work.

The following current consumption values are measured from a complete RH-29.

Vbatt = 3.6V

Measured nominal currents are drawn from the main battery.

Measurements have been made with a current probe connected to an oscilloscope.

Operating mode	Current consumption
Idle	90 mA
2w audio call (backlights off)	250 mA

Copyright © 2004 Nokia Corporation
Company Confidential

Troubleshooting Paths

Dead or jammed device

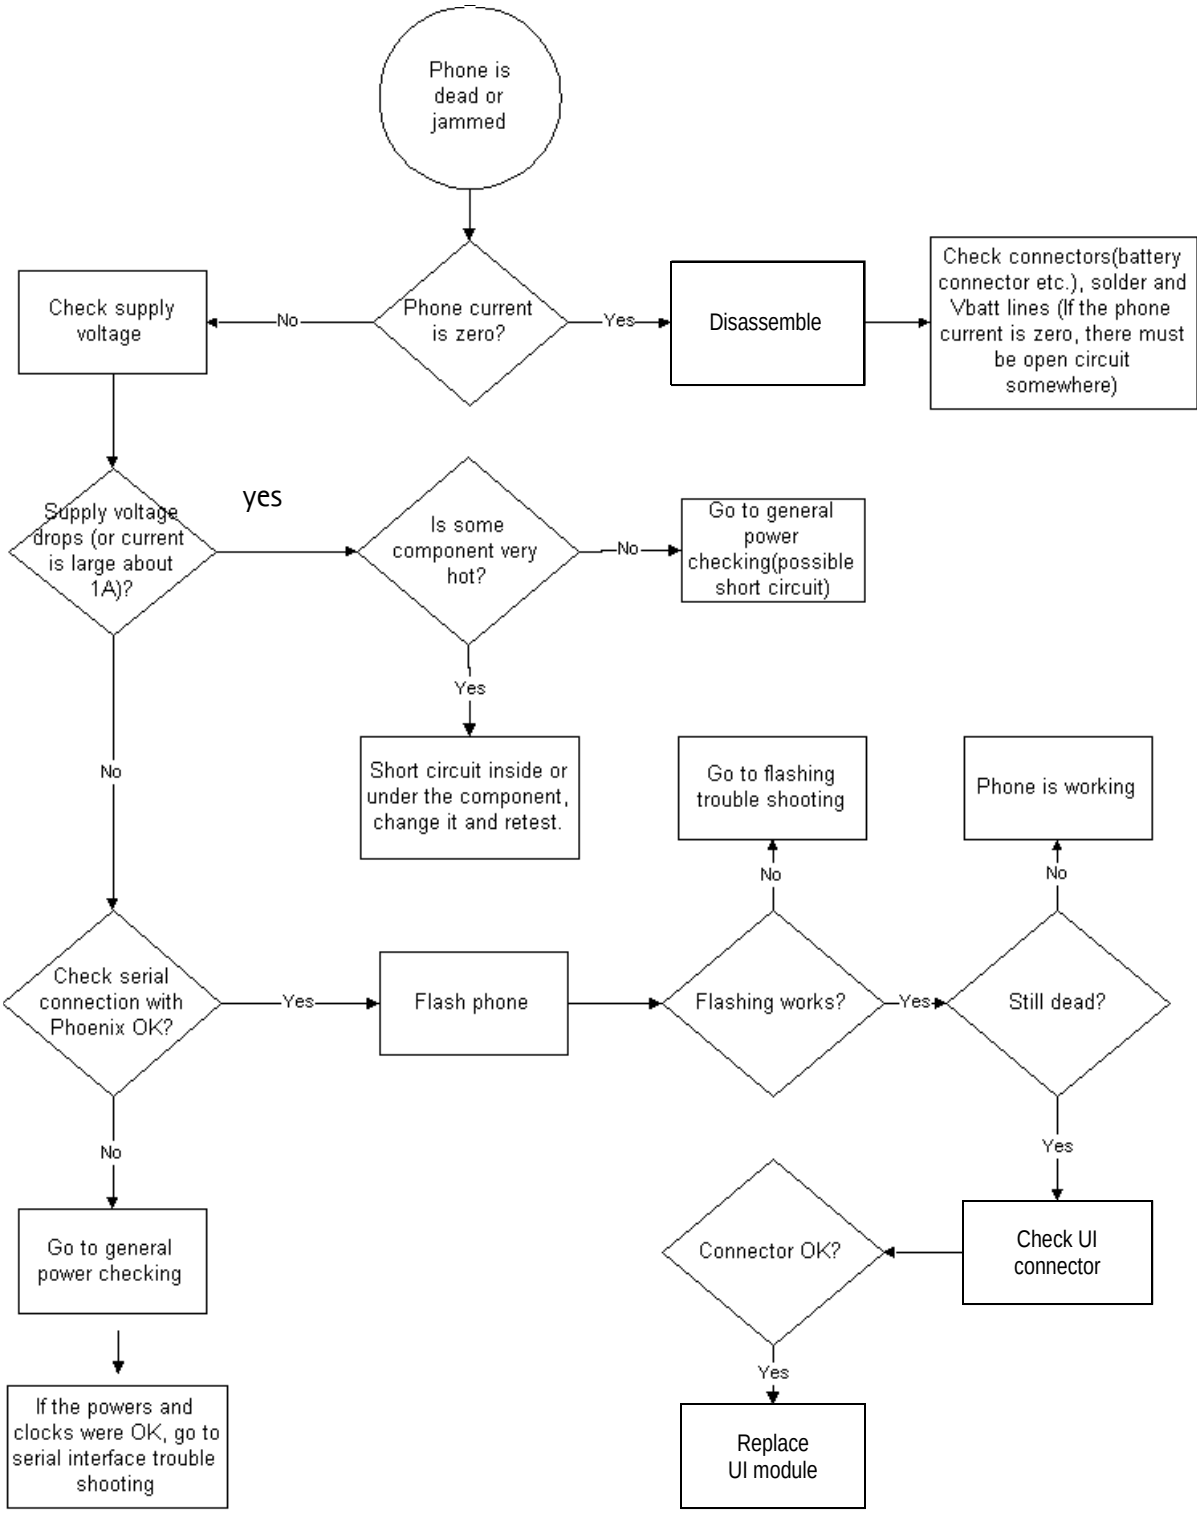

Copyright © 2004 Nokia Corporation
Company Confidential

Partially damaged device

If the device is working, but some functionality is missing try to localize where the problems is and see relevant part of this manual. E.g audio is not working see "Audio Troubleshooting", if charging is not working see chapter Charging troubleshooting etc.

Most common symptoms reported by customer

In this chapter is described most common symptoms reported by customers when the device is brought in for service. Some tips where the trouble can be found are given also. When troubleshooting use these tips and follow the given troubleshooting path.

Most common symptoms for audio problems

"Earpiece sound is missing"
"Handsfree sound is missing"
"Headset is not recognized"
"Microphone is not working"
"Volume cannot be adjusted"
" Ringing tones does not work"
"Audio volume too low"

If symptom is something like above see audio troubleshooting.

Symptoms related to energy management

"Phone does not stay on"
"Charging is not working"
"Time is lost during battery change"
"Charging takes too long"
"Operating time is very short"

These symptoms lead to relevant part of energy management troubleshooting

Problems related to UI module:

"UI-module keypad is not working"
"Backlight is dim"
"Backlight not even"
"Backlight is blinking"
"Keypad or display backlight is not working"
"Display related problems"

See UI- module troubleshooting.

Most common RF related symptoms:

"Call cannot be made"
"Phone does not find signal"
"Call is often dropped"
See RF troubleshooting

Copyright © 2004 Nokia Corporation
Company Confidential

ASIC is changed

ASIC's can be changed only at a defined service level.

UEM changed

If UEM is changed baseband calibrations should be made. New IMEI must be programmed also. ZOCUS calibration is not necessary.

UPP_WD2 changed

IMEI must be reprogrammed.

ZOCUS changed

Zocus must be re-calibrated

Test points

Test Point	Signal	Test Point	Signal	Test Point	Signal
J109	UEMInt	J203	TXQD	J477	SIM IF
J123	SLEEPCLK	J204	AUXD	J482	MMC IF
J124	SLEEPX	J311	FLASH CE	J483	MMC IF
J125	PURX	J312	FLASH CE	J484	MMC IF
J170	RFCLK_I	J314	SDRAMCLK	J485	MMC IF
J190	EARDATA	J315	FLASH CLK	J487	MMC IF
J191	MICDATA	J334	Shutdown Audio PA	J488	MMC IF
J192	SIMIODAI	J390	Current sense resistor	J490	MMC IF
J193	SIMCLKI	J391	Current sense resistor	J492	MMC IF
J194	SIMIOCTRL	J392	Current sense resistor	J493	MMC IF
J195	MBUSTX	J393	Current sense resistor	J495	MMC IF
J196	MBUSRX	J470	SIM IF	J496	MMC IF
J197	FBUSTXI	J471	SIM IF	J497	MMC IF
J198	FBUSRXI	J472	SIM IF	J498	MMC IF
J199	RFCONVCLK	J473	SIM IF	J499	MMC IF
J200	RXID	J474	SIM IF		
J201	RXQD	J475	SIM IF		
J202	TXID	J476	SIM IF		

Copyright © 2004 Nokia Corporation
Company Confidential

"CONTACT SERVICE" on display

CONTACT SERVICE on display (Self-tests by Phoenix)

Display information: **"Contact Service"**

This fault means that software is able to run and thus the watchdog of UEM can be served.

Self-test functions are executed when the phone is powered on and if one or more self-test functions fail, the message "Contact Service" is shown on the display.

MCU self-test cases can be split into two categories: The ones that are executed during power up and the ones that are executed only with a PC connected. These test and the items included are as follows:

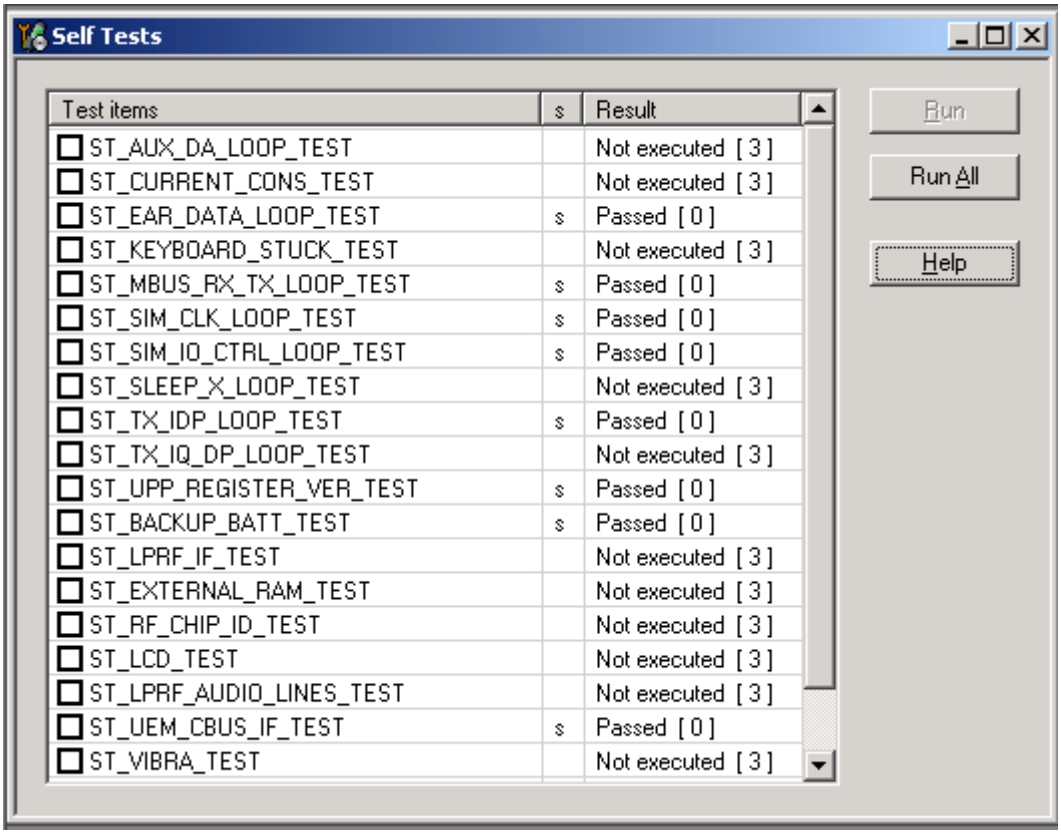

If some self-test failed, see relevant chapter in this troubleshooting document.

Copyright © 2004 Nokia Corporation
Company Confidential

1CK Baseband HW Subarea Troubleshooting

Flashing troubleshooting

RH-29 has three memory components installed on the main PWB. The best indication of which one is causing problems can be obtained by flashing the device. It has to be kept in mind that all three flashes are interfaced with UPP WD2 asic that might it self have some problems. The necessary steps are described below. Phoenix error messages during flashing greatly help on defining what is wrong. To be able to flash the device, most device BB area components must function properly.

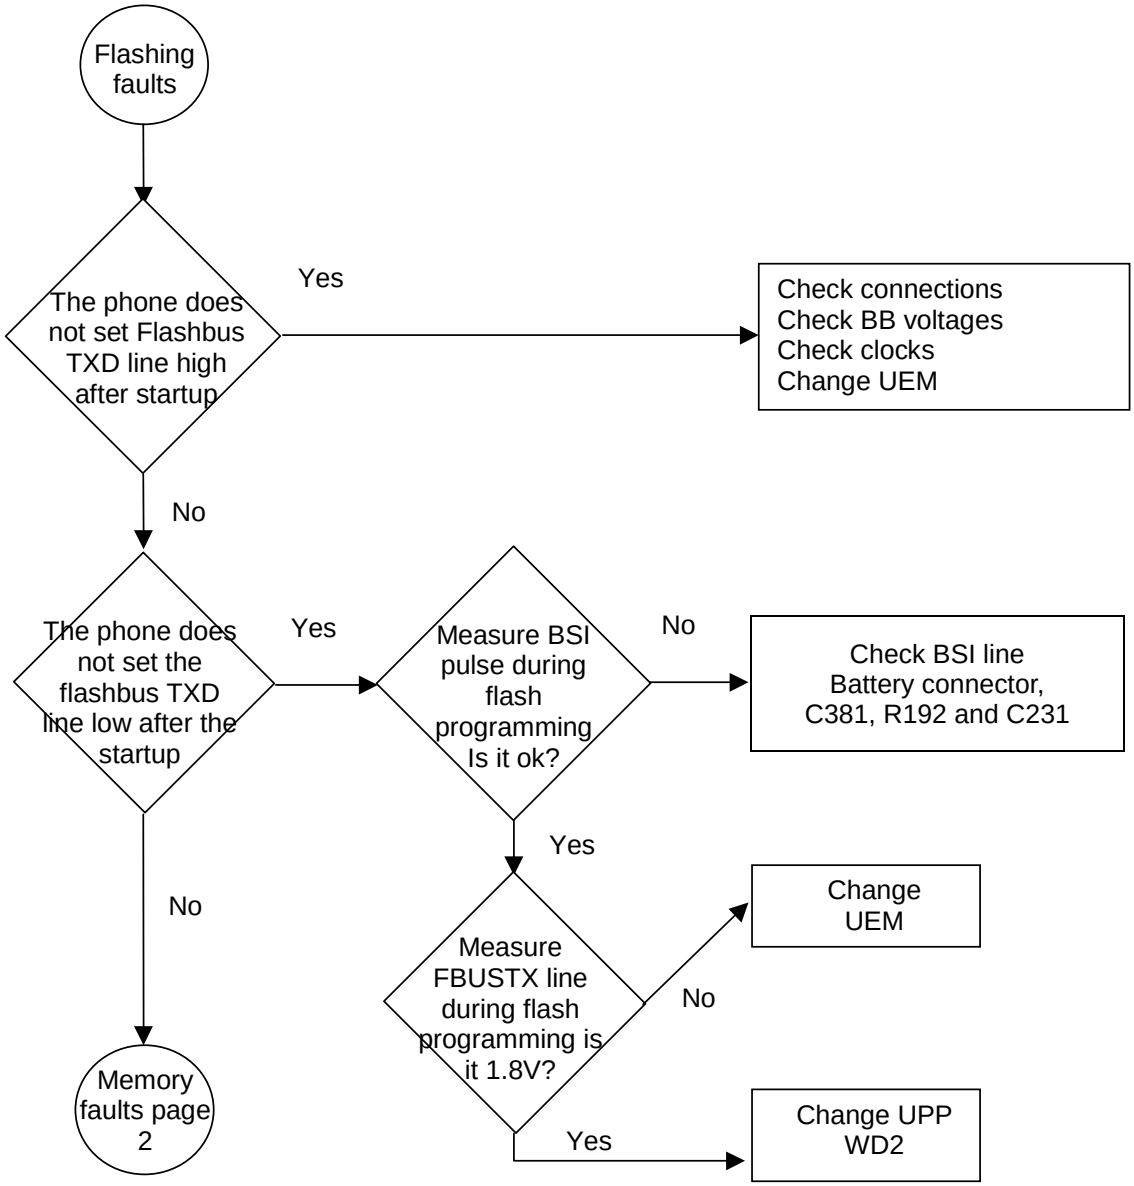

Copyright © 2004 Nokia Corporation
Company Confidential

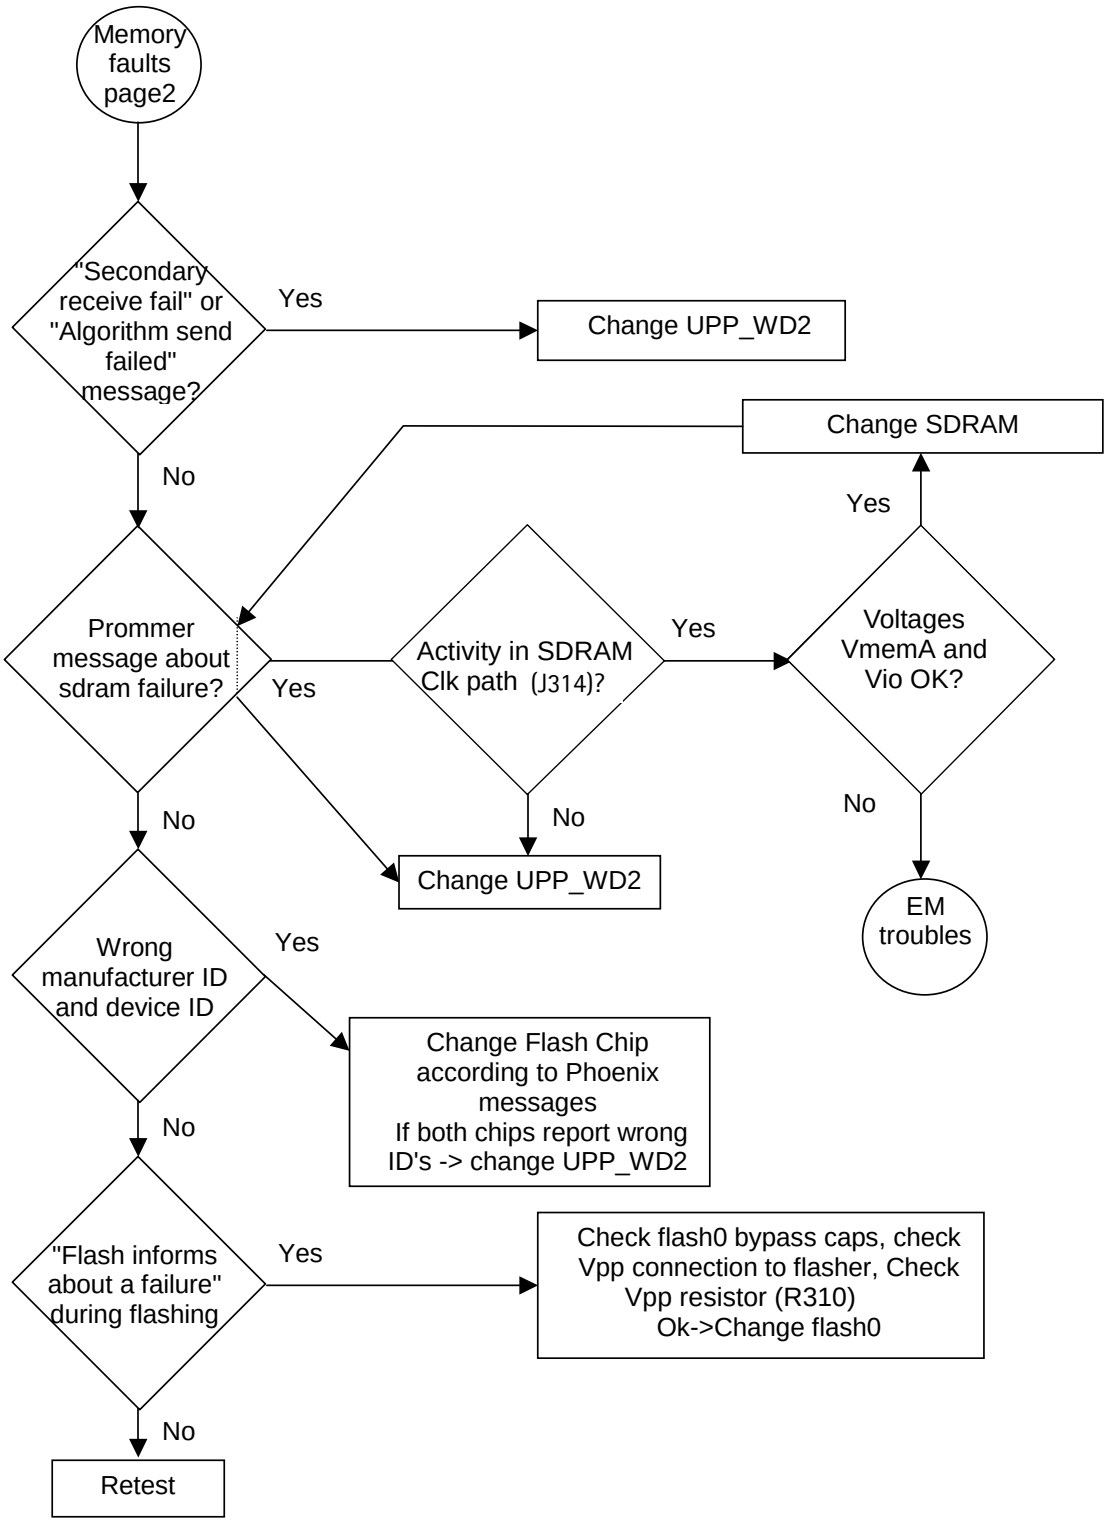

Copyright © 2004 Nokia Corporation
Company Confidential

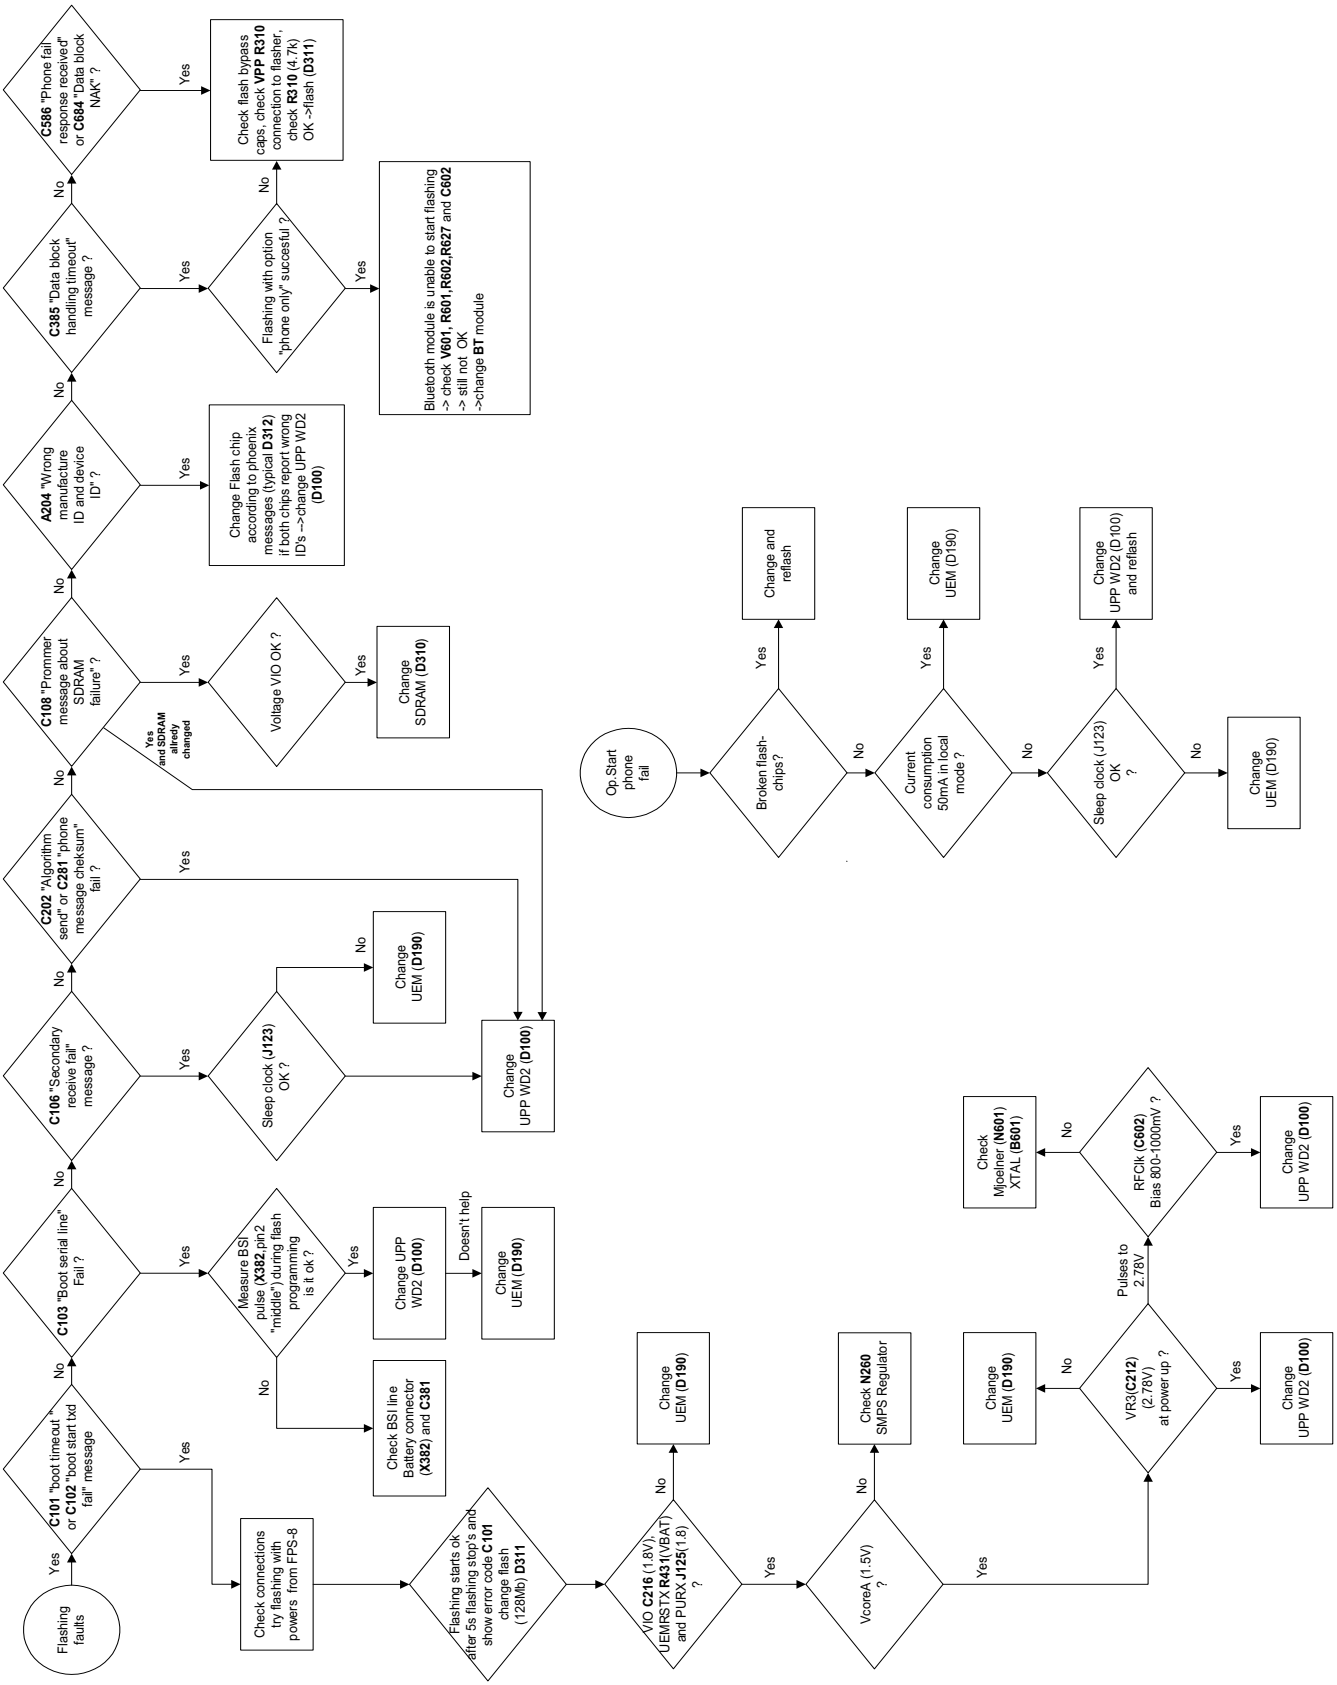

Copyright © 2004 Nokia Corporation
Company Confidential

Energy management troubleshooting

Device does not stay on

If the device is switched off without any visible reason, there may be problems in the following areas:

- UEM watchdog problem (WD is not updated by SW)
- BSI line problem (BSI line is floating => contact failure)
- Battery line problem
- Soldering problem

The most likely reason is UEM WD (watchdog), which turns the device off after about 32 seconds if SW is jammed.

This may caused by SW problem, UPP_WD2 problem (Not server by SW), UEM or memory malfunctions.

The following tests are recommended:

- General power checking
- Clocks
- Memory testing
- Serial Interface

If there is something wrong in BSI line, the device seems to be dead after the power key is pressed. However the regulators of the device are on a few seconds before the power-down.

This mode can easily be detected from the current consumption of the device. After a few seconds the current consumption drops almost to 0 mA.

In this case check component or soldering

- Battery connector X382
  EMI-filter R381
  UEM D190 (pin number C2)

If phone boots to TEST or LOCAL mode with normal battery, BSI is short circuited to ground. Check EMI-filter and filtering capacitors, which are located to BSI.

Copyright © 2004 Nokia Corporation
Company Confidential

General power checking

Use service tool SF-20. Battery voltage should be at least 3.6V. After phone disassembly, use module jig MJ-21.

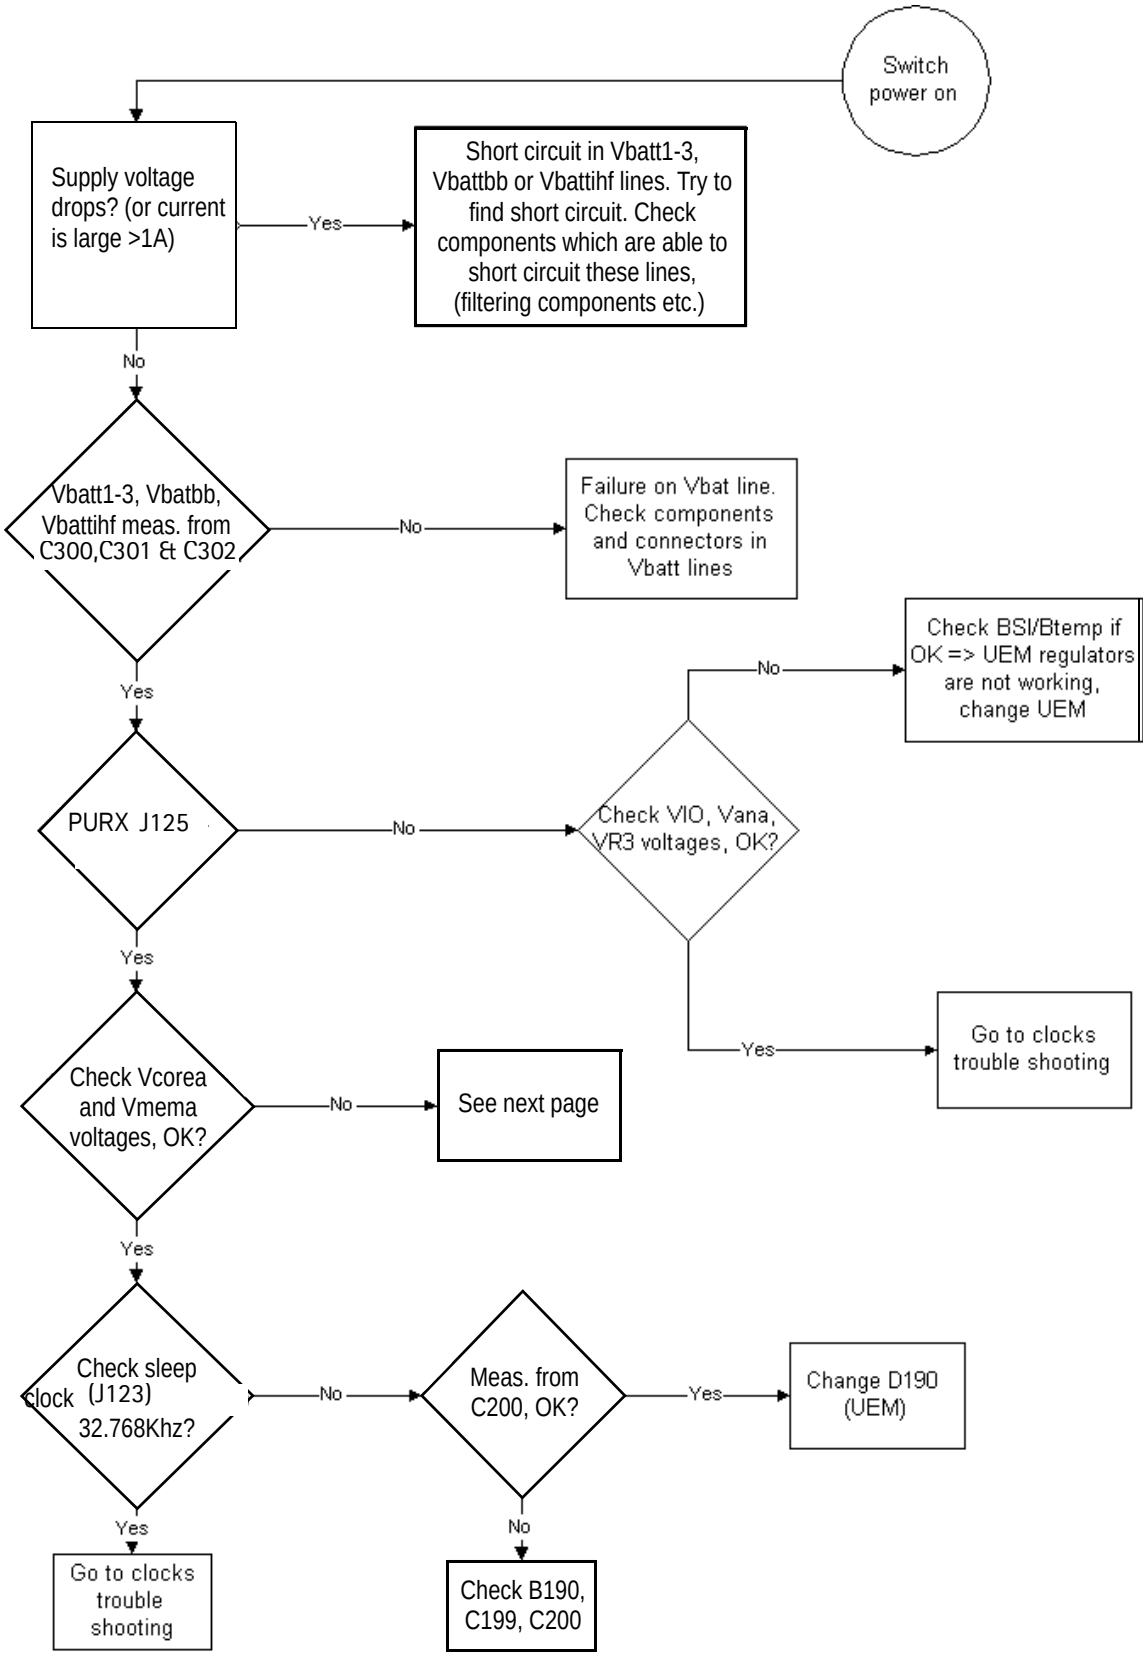
Switch power on
Supply voltage drops? (or current is large >1A)
Yes
Short circuit in Vbatt1-3, Vbattbb or Vbattihf lines. Try to find short circuit. Check components which are able to short circuit these lines, (filtering components etc.)
No
Vbatt1-3, Vbatbb, Vbattihf meas. from C300,C301 & C302
No
Failure on Vbat line. Check components and connectors in Vbatt lines
Yes
PURX J125
No
Check VIO, Vana, VR3 voltages, OK?
No
Check BSI/Btemp if OK => UEM regulators are not working, change UEM
Yes
Go to clocks trouble shooting
Yes
Check Vcorea and Vmema voltages, OK?
No
See next page
Yes
Check sleep clock (J123) 32.768Khz?
No
Meas. from C200, OK?
Yes
Change D190 (UEM)
Yes
Go to clocks trouble shooting
No
Check B190, C199, C200

Copyright © 2004 Nokia Corporation
Company Confidential

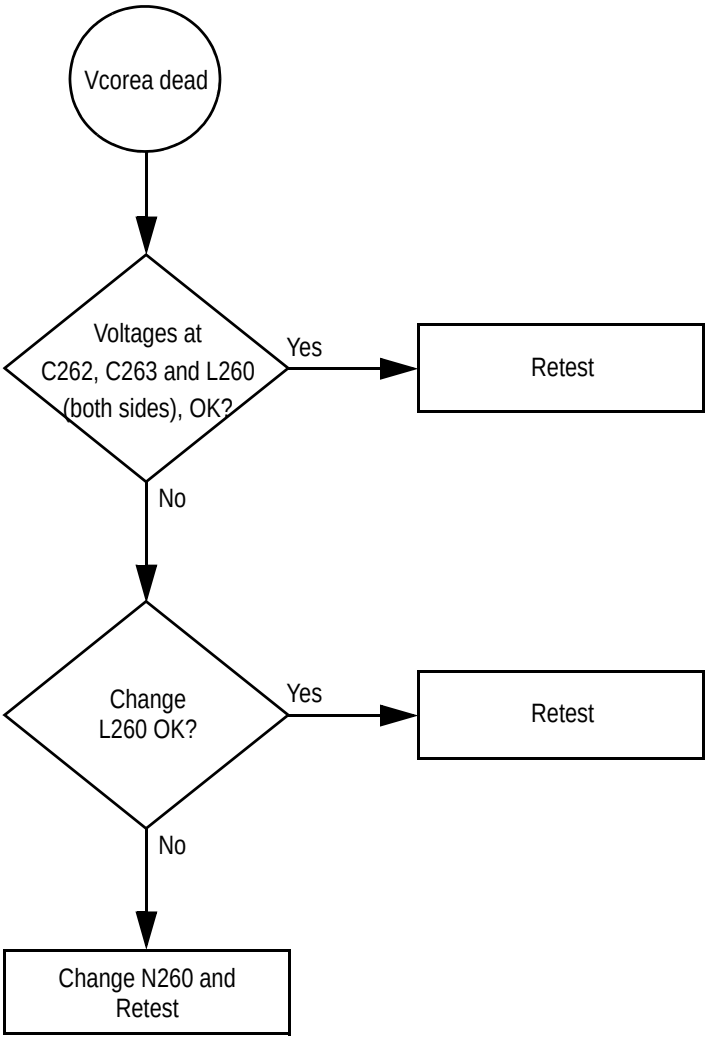

Copyright © 2004 Nokia Corporation
Company Confidential

Power key troubleshooting

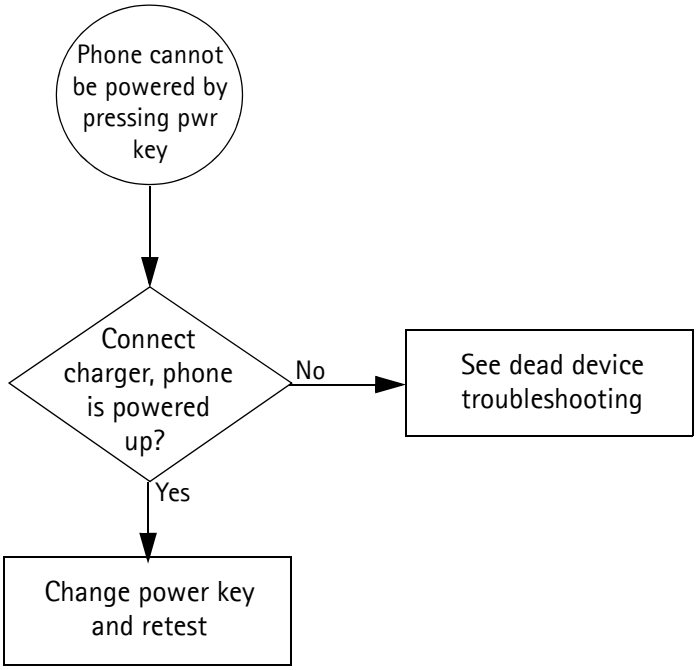
Phone cannot be powered by pressing pwr key
Connect charger, phone is powered up?
No
See dead device troubleshooting
Yes
Change power key and retest

Clocks troubleshooting

Clocks include the following:

- RF-clock
- DBUS, CBUS clocks
- Flash and SDRAM clocks
- Sleep clock
- Bluetooth clock
- SIM clock
- MMC clock

The main clock signal for the baseband is generated from the voltage controlled crystal oscillator VCXO. This 26 MHz triangle wave clock signal is supplied to OSC_IN pin of Mjoelner and out to UPPWD2. Inside UPPWD2 the clock frequency is divided to 13 MHz

Copyright © 2004 Nokia Corporation
Company Confidential

and then fed to RFCLK.

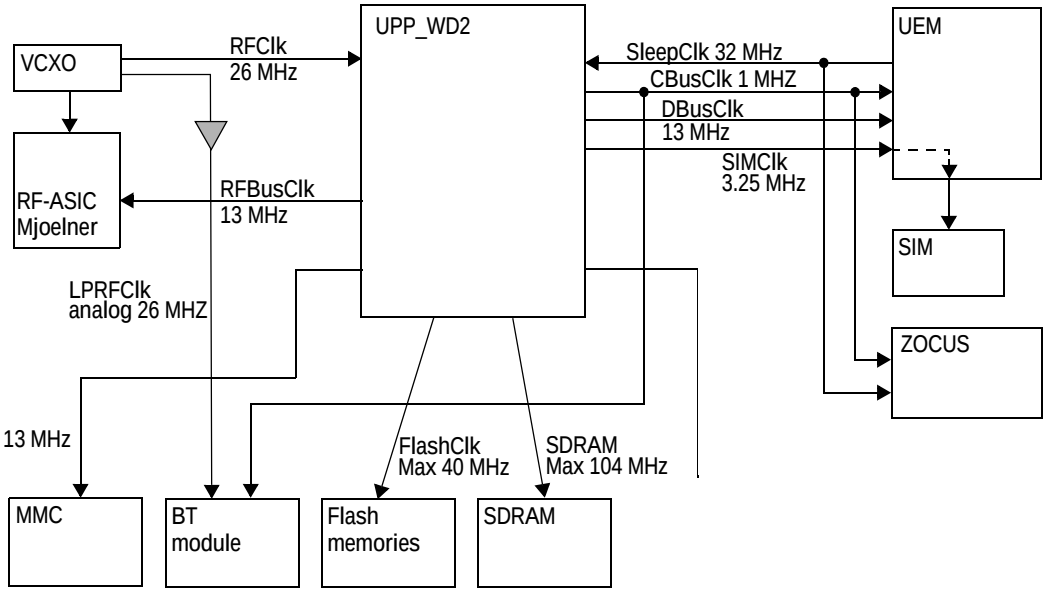

In SLEEP mode the VCXO is off. UEM generates low frequency clock signal (32.768 kHz) that is fed to UPP_WD2, Bluetooth and ZOCUS.

When the flashing of the device does not succeed, but powering is OK, follow these instructions.

Note: The absence of clocks may indicate that the device (put phone to LOCAL mode when the sleep is not allowed or press buttons so that phone is not in sleep mode) is in sleep mode. Make sure that the device is not in sleep during clocks measuring.

IMPORTANT: Clock signals have to be measured with 1MΩ (or greater) probes!

Measure signal from J170. This should be 26Mhz clock signal. See RF Troubleshooting for further information.

Check the crystal oscillator (B190) is oscillating at 32.768kHz frequency. If not change B190. If OK measure sleepclk from J123. Frequency should be the same 32.678kHz (see Figure 1, “Sleep clock,” on page 17 below.) If not change UEM.

Copyright © 2004 Nokia Corporation
Company Confidential

Figure 1: Sleep clock

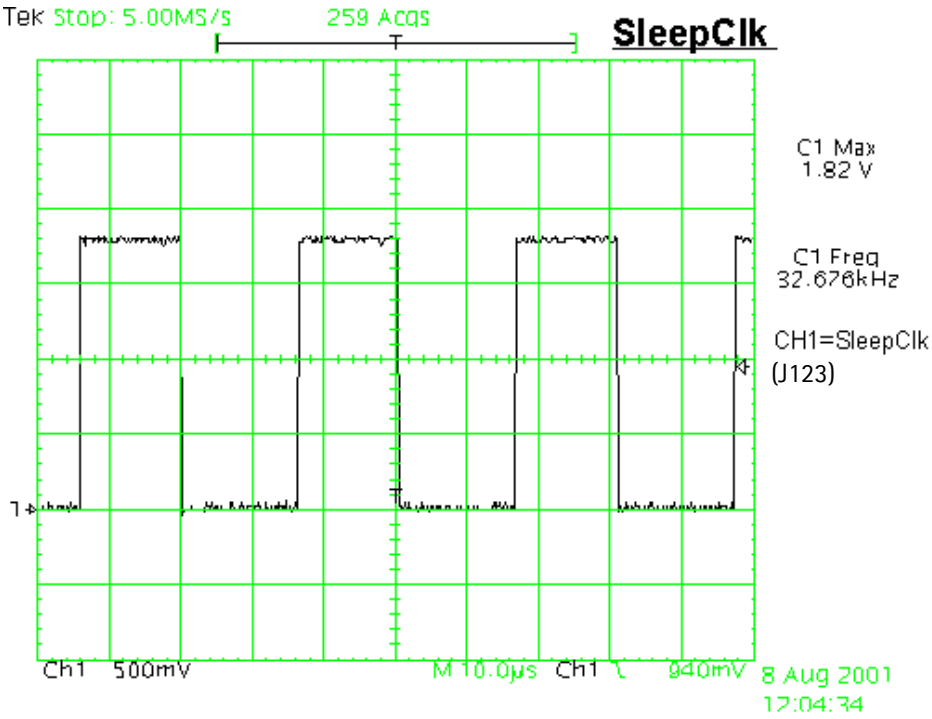

Charging checking

Use the BL6-C battery and JBV-1 calibration set to test charging. (NOTE: power supply cannot be charged if it not has a current sinking capability.) When you are charging totally empty battery, remember that start-up charging might take a little bit longer time than normal. During this time display is blank.

If charger is not NMP approved type and its current and voltage is not within NMP charger window then software does not start charging and there is "NOT CHARGING" on the display. Voltage should be between 5.3V - 9.5V and current between 200mA – 900mA

Remove and reconnect battery and charger few times before you start to measure device. This check ensures that the fault really exists.

(Refer to "Charging troubleshooting")

Copyright © 2004 Nokia Corporation
Company Confidential

Figure 2: Charging troubleshooting

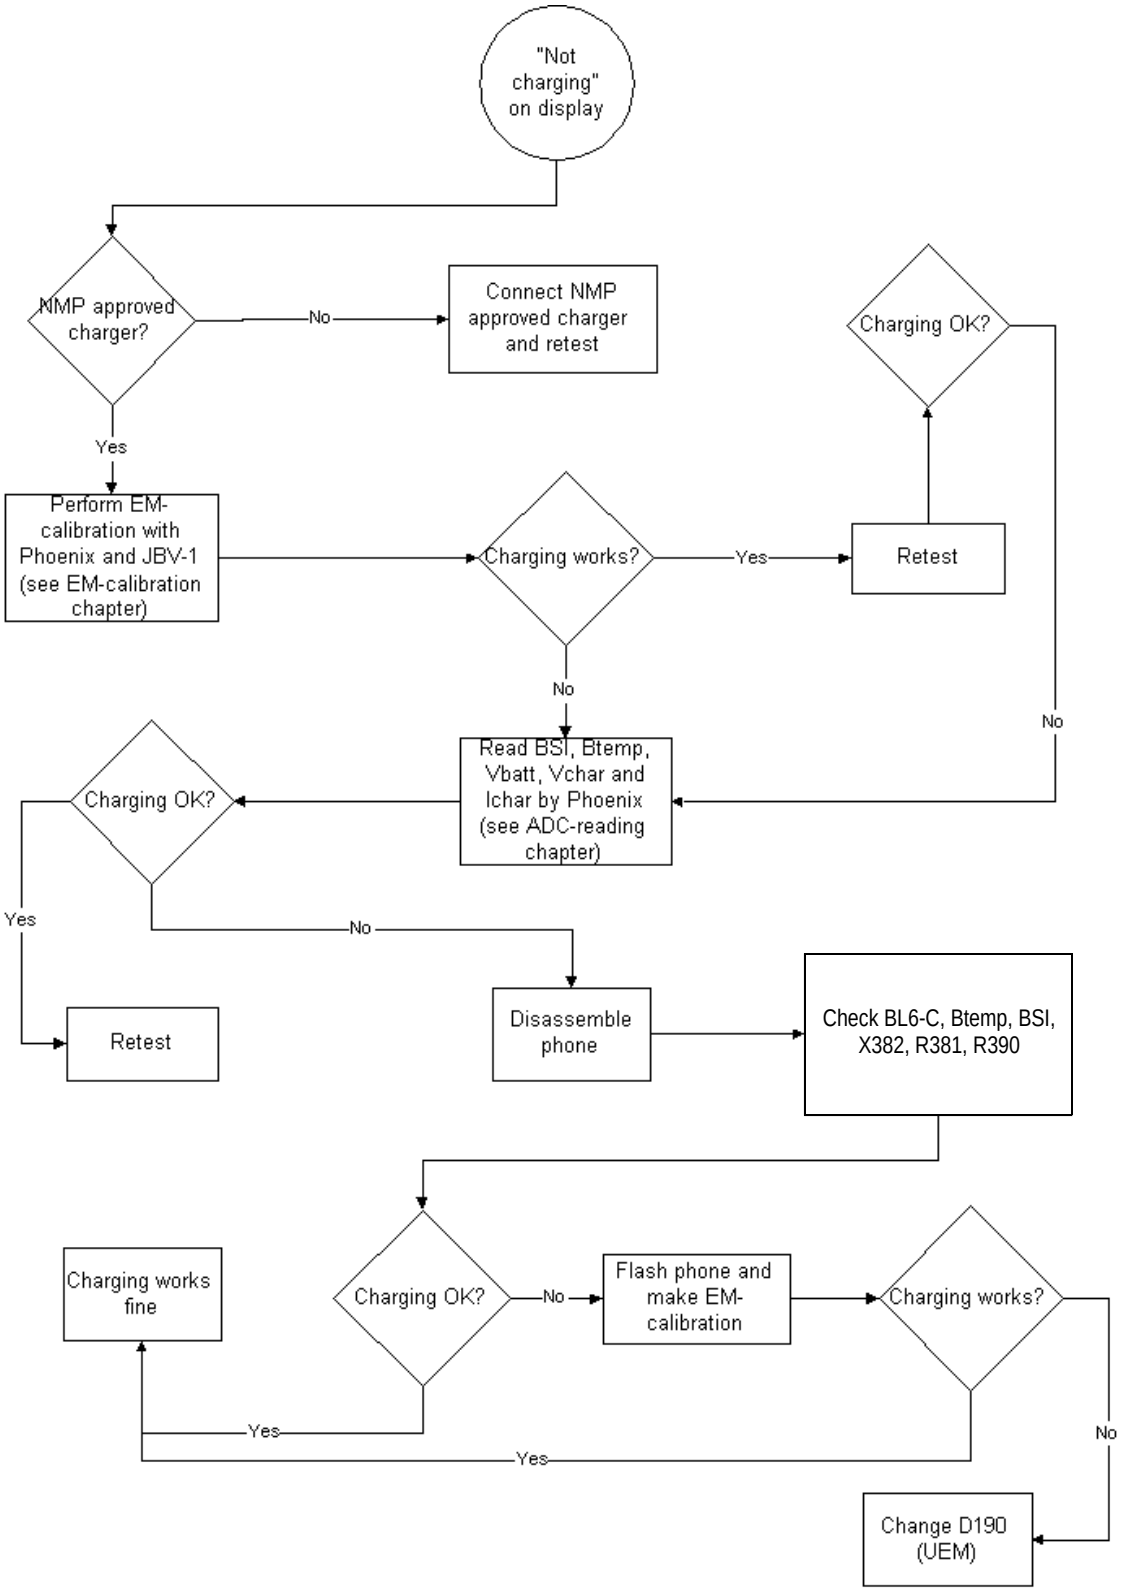

Copyright © 2004 Nokia Corporation
Company Confidential

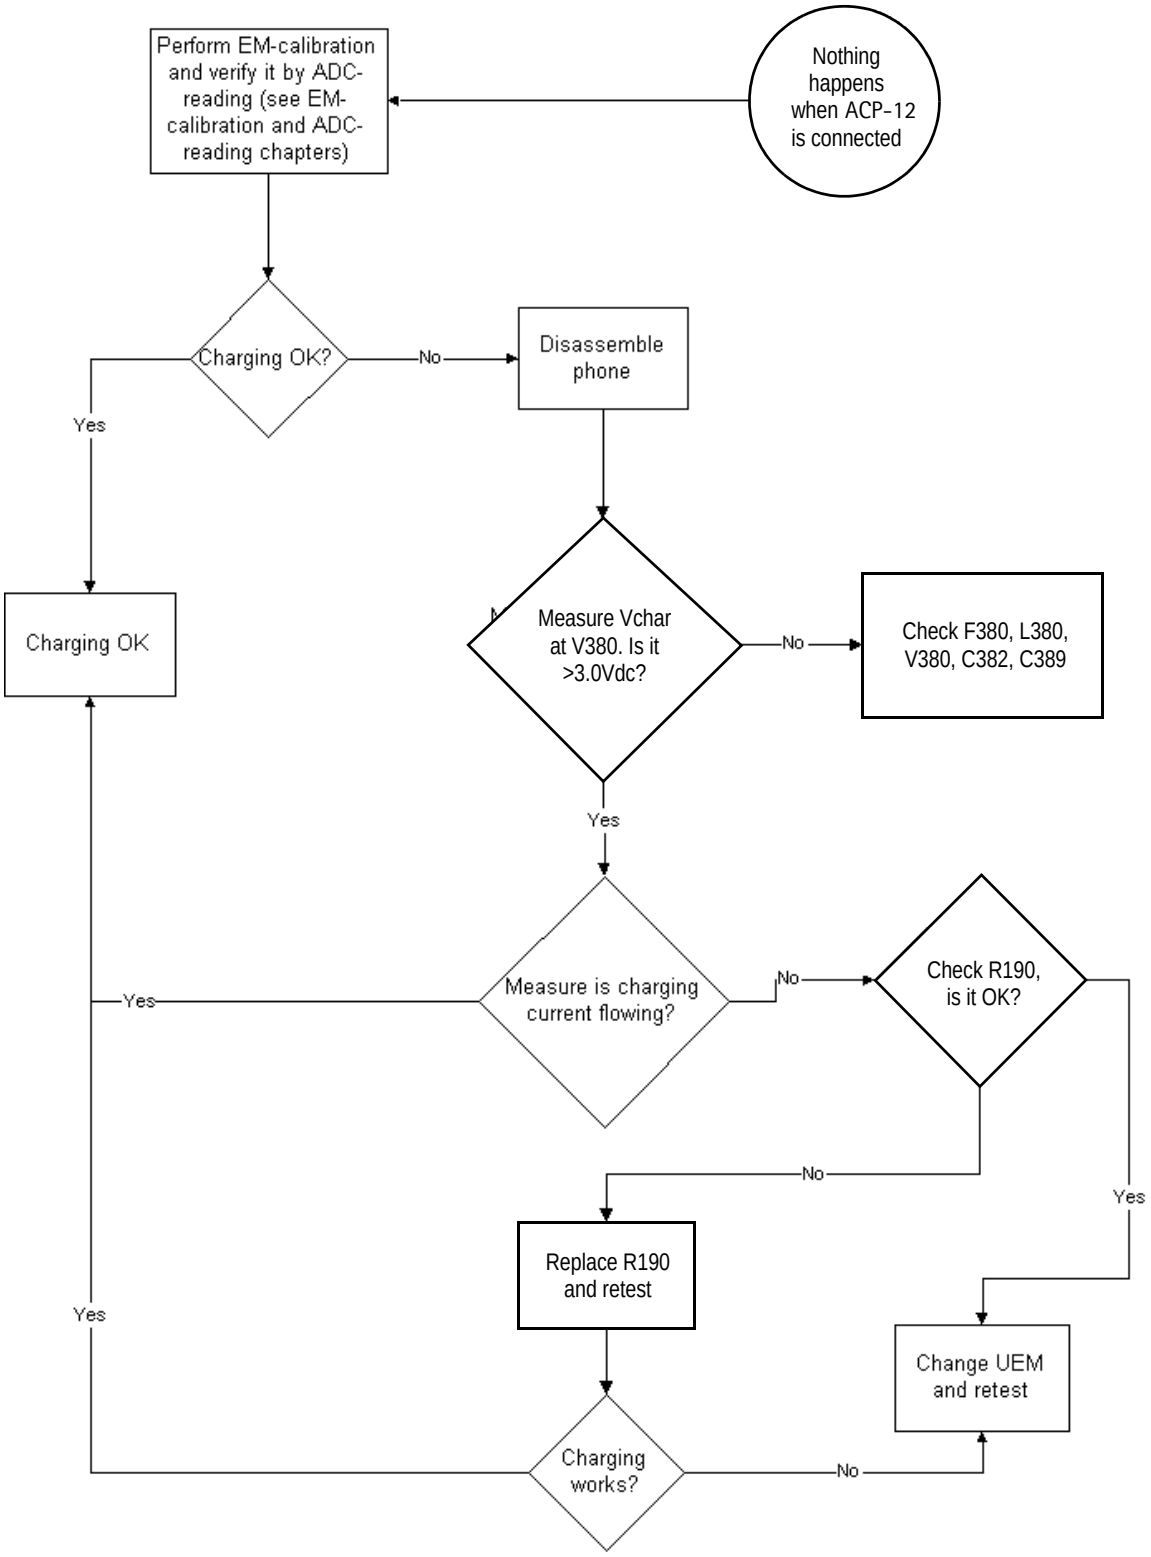

Copyright © 2004 Nokia Corporation
Company Confidential

Energy management calibration

During energy management calibration A/D-converter, BSI, Btemp, Battery voltage, Charger voltage and Charger current are calibrated.

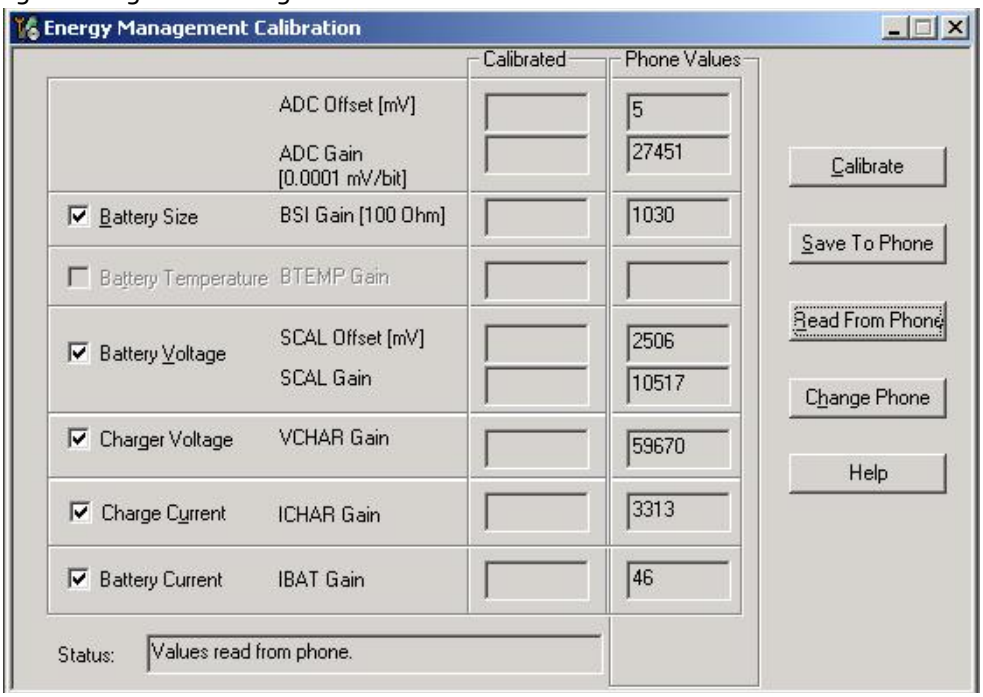

Limits for calculated calibration values are as follows:

Channel	Low	High
ADC Offset	-50	50
ADC Gain	26000	29500
BSI Gain	860	1180
Vbatt Offset	2400	2600
Vbatt Gain	10000	11000
Vchar	57000	63000
Ichar	3600	5000

ADC-offset over limits:
Inspect BSI line and components in it (R381, Pull-up resistor R192). If these are OK, change UEM.

BSI Gain over limits:
Inspect BSI line and components in it (R381, Pull-up resistor R192). If these are OK, change UEM.

Vbatt offset and Gain:
Inspect Vbatt lines and component in it.

Vchar over limits:

Copyright © 2004 Nokia Corporation
Company Confidential

Inspect components which are connected Vchar line: F380, L380 and V380.

Ichar over limits:
Inspect components which are connected at Vchar line. If those are OK, First change current sense resistor (R190), if calibration is not still successful change UEM.

Calibration can be checked using ADC-readings. Known voltages, currents and resistances are fed and read by ADC-readings, read values and known values can be compared.

ADC-reading

Divided and scaled battery voltage, Charger voltage, Charger current, BSI and Btemp values can be read by this tool. Read values few times before you can be sure that results are accurate.

NOTE: IF Vbatt Scaled and Divided unit results are different default calibration values are used. In this case perform EM-calibration to get full performance of phone.

Copyright © 2004 Nokia Corporation
Company Confidential

Maximum tolerances are:

Reading	Check point	Tolerance
Vbatt SCAL_	4.2V	± 25mV
Vchar	8.4V	± 40mV
Ichar	500mA	± 20mA
BSI	91k	± 1.3kohm
Btemp	47k	± 5% <+25°C

Backup battery

Symptom of backup battery fault is

Real Time Clock loses the correct time during short main battery removal.

The same symptom can also be seen when the backup battery is empty. About 5 hours is needed to fully charge the backup battery in the device. NOTE: Backup battery is charged only the same time with main battery charging. Or when the device is LOCAL or TEST mode.

Always check the backup battery visually for any leakage or any other visual defect.

Check that the backup battery is correctly mounted in the device before closing the cover.

Check with Phoenix that backup battery is OK

Measure the voltage of backup battery

- Normal operation when the voltage is > 2.0V
- Fully charged when the voltage is about 3.2V (because of large internal impedance voltage won't stay above 3.0V a long time after charging is disabled)

Enable backup battery charging (start to charge main battery or boot device to LOCAL or TEST mode)

Measure voltage of backup battery during charging, It should arise if it is not 3.2V, yet.

When the voltage is over 2.0V for sure, check backup battery with Phoenix.
-> If not OK then D190 is faulty.

Ensure that the RTC is running.

Copyright © 2004 Nokia Corporation
Company Confidential

SIM card

The whole SIM interface locates in two chips UPP_WD2 and UEM. UEM contains the SIM interface logic level shifting. UPP provides SIMClk through UEM to the SIM. SIM interface supports both 3 V and 1.8 V SIMs.

UPP & UEM SIM connections

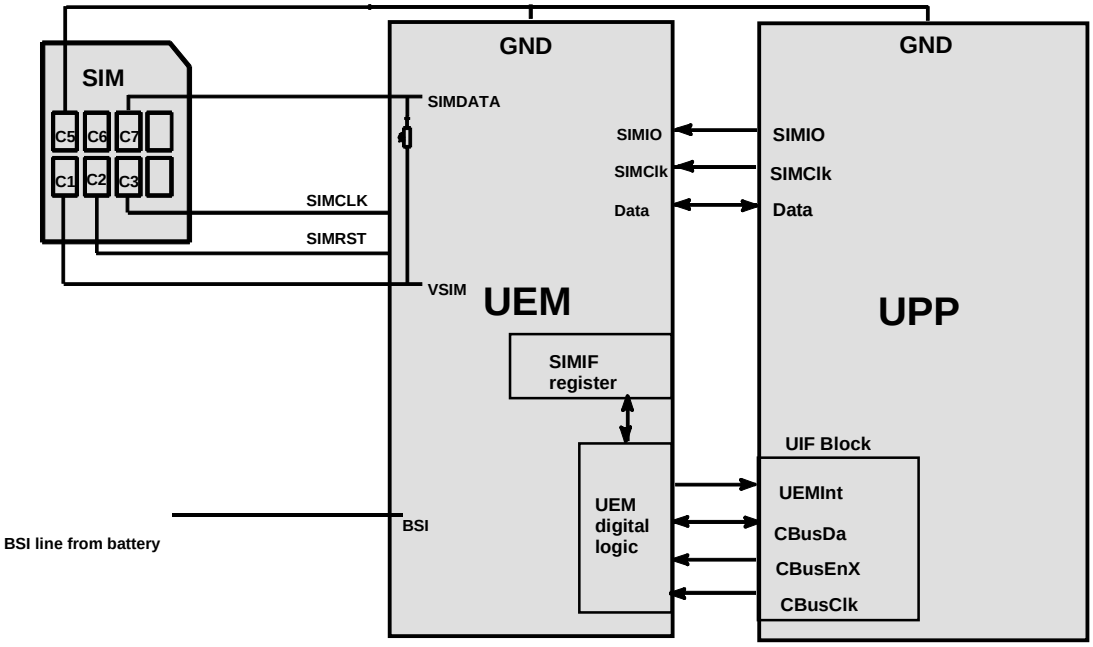

The SIM power up/down sequence is generated in the UEM. This means that the UEM generates the RST signal to the SIM. Also the SIMCardDet signal is connected to UEM. The card detection is taken from the BSI signal, which detects the removal of the battery. Monitoring of the BSI signal is done by a comparator inside UEM. The threshold voltage is calculated from the battery size specifications.

The SIM interface is powered up when the SIMCardDet signal indicates "card in". This signal is derived from the BSI signal. SW tries first to power up the SIM with 1.8 V. If this doesn't succeed power up is repeated with VSIM switched to 3 V.

The data communication between the card and the phone is asynchronous half duplex. The clock supplied to the card is in GSM system 1.083 MHz or 3.25 MHz. The data baudrate is SIM card clock frequency divided by 372 (by default), 64, 32 or 16.

Copyright © 2004 Nokia Corporation
Company Confidential

Figure 3: SIM Power Up.

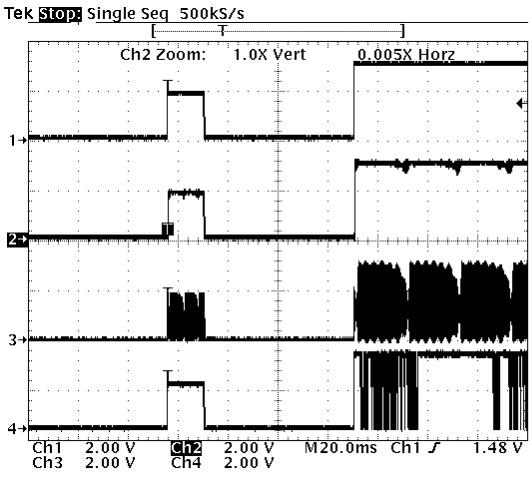

Ch1 Vsim
Ch2 Reset
Ch3 Clock
Ch4 I/O

Measured with 3Vsim

Figure 4: SIM answer to reset.

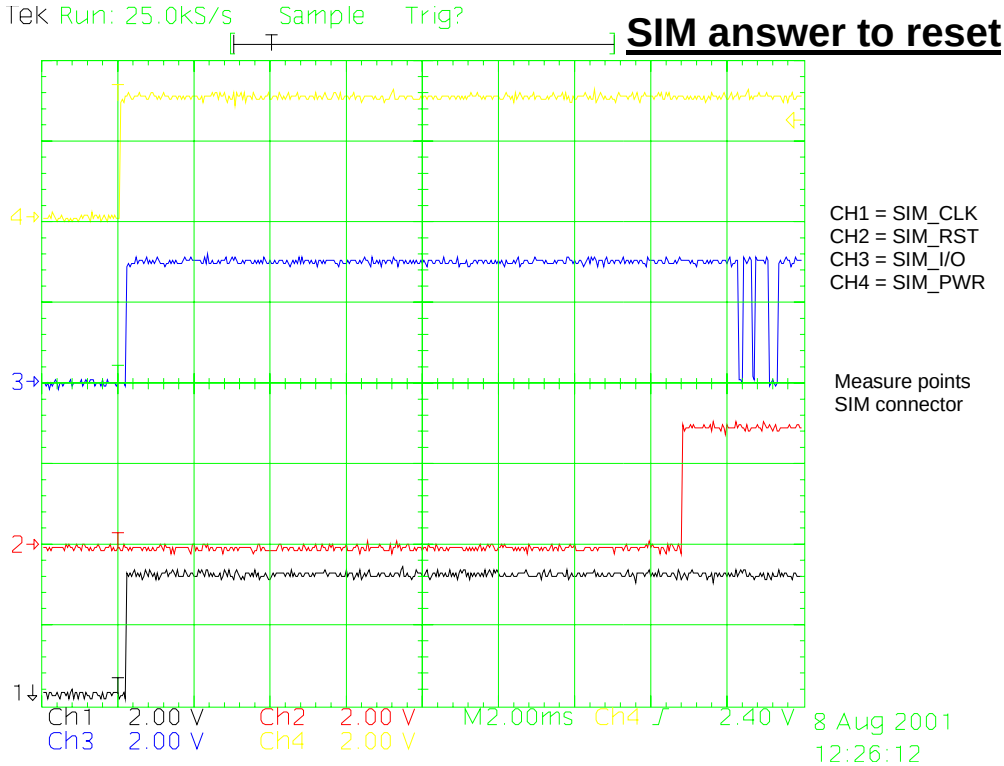

Copyright © 2004 Nokia Corporation
Company Confidential

Figure 5: SIM Clk 3.25MHz.

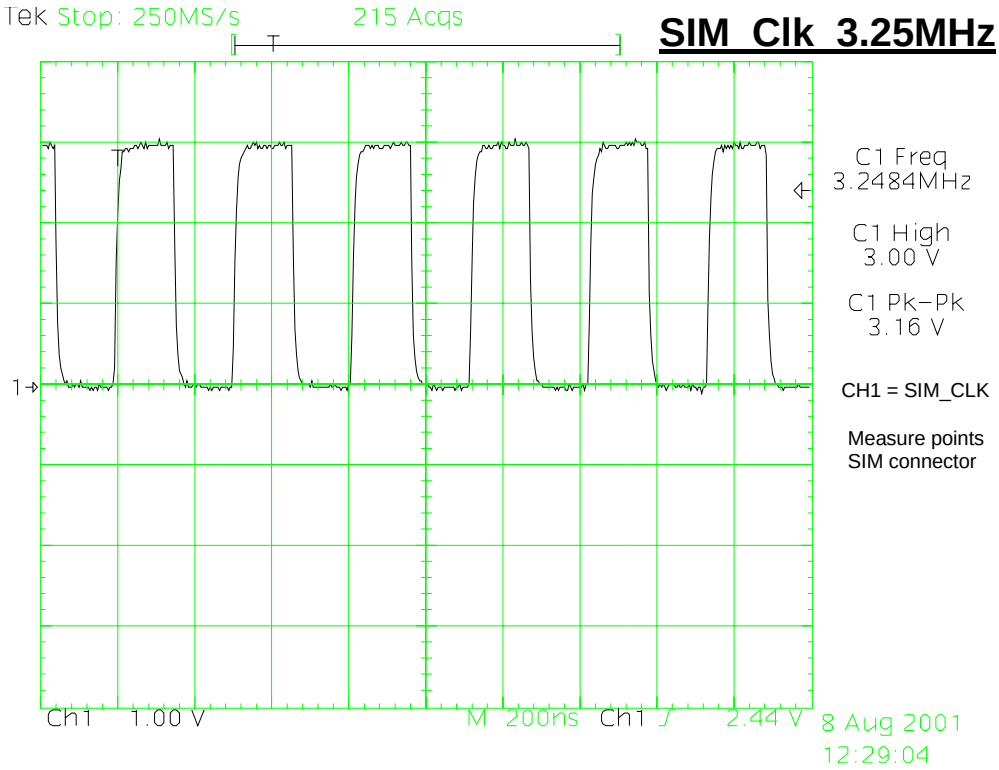

Remember to check the two PHOENIX test cases before changing UPP!!!!

Copyright © 2004 Nokia Corporation
Company Confidential

"Insert SIM Card" in device display although card is inserted

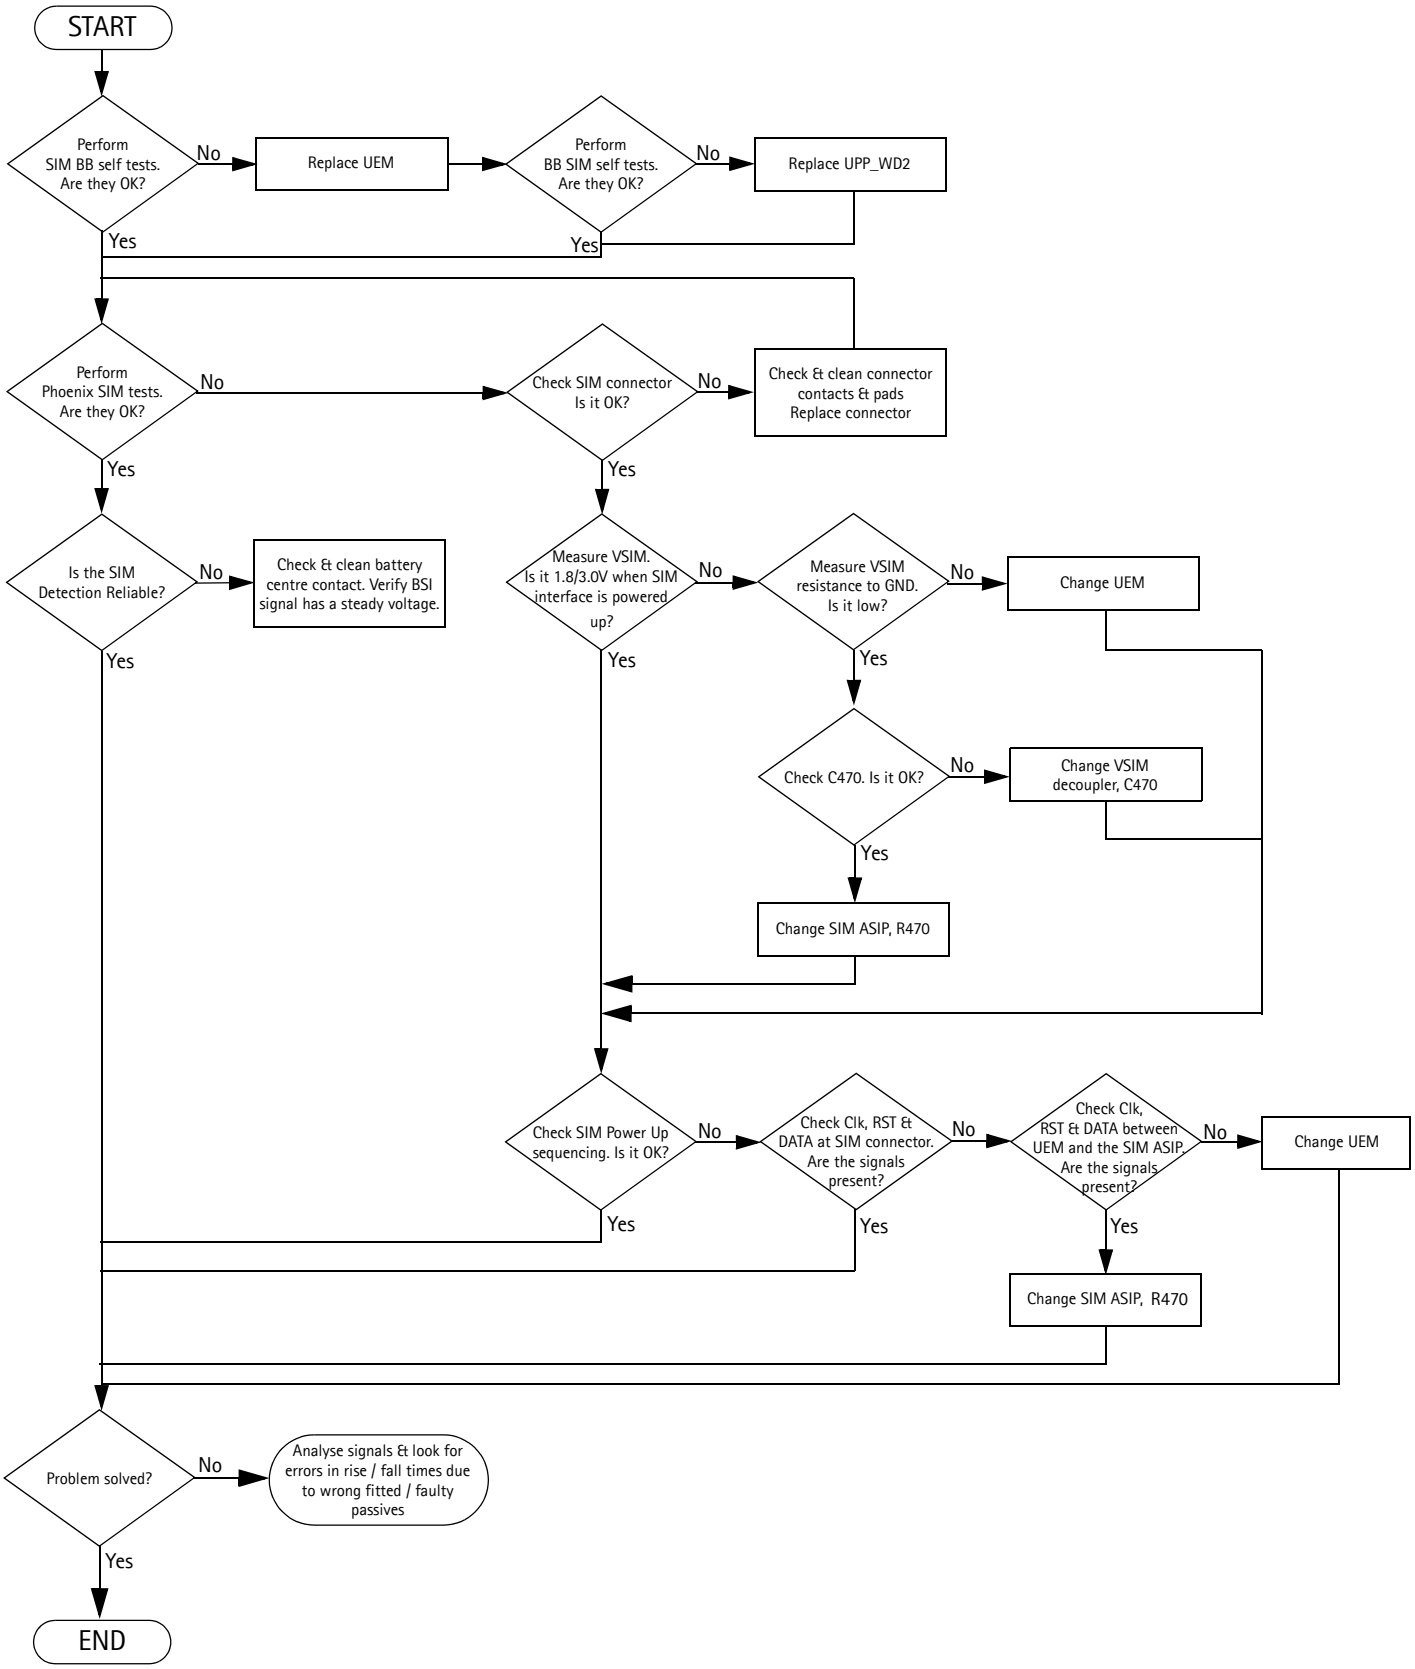

Copyright © 2004 Nokia Corporation
Company Confidential

Memory troubleshooting

Most memory related errors are found through flashing the device, flashing the device is therefore recommended before any of the steps described in this chapter. Check flashing troubleshooting section first.

There are however a few memory related errors that cannot be found through flashing.

- - SDRAM(D310) partially damaged. This can mean that the SDRAM component itself is partially damaged and all the memory locations cannot be successfully read or there is a soldering problem somewhere either under UPP or SDRAM. There is a BB self test for testing SDRAM component quite thoroughly, but the problem is that if SDRAM doesn't function properly one may not be able to run those tests as SDRAM is used during the device boot and self-test cannot be run if the device hasn't booted.

- DEVICE may inform about being "out of memory " more often than it should

- - flash1 (D312) is partially/totally damaged. During flashing the manufacturer, device and revision id's are read, but flashing is done based on id's of the flash0 (D311). This means that one cannot see any error messages displayed on Phoenix window during flashing if flash1 is failing. Id's are however displayed on the Phoenix window and successful read of flash1 id's can be checked from there.

Copyright © 2004 Nokia Corporation
Company Confidential

Serial interface troubleshooting

CBUS

CBUS is a three wire serial interface between the main baseband components. The bus consists of data, clock and bus_enable signals. In RH-29 the bus is connected from UPP WD2 to ZOCUS, UEM and LPRF. UPP_WD2 takes care of controlling the traffic on the bus.

If the interface is faulty from the UPP WD2's end the phone won't boot properly as powering configurations don't work. Traffic on the bus can be monitored from three pins on the LPRF module. Pins 34, 35 and 36.

In the pictures below CBUS traffic at boot up is shown. CbusEnx is connected to Ch1, Cbus Da to Ch2 and CbusClk to Ch3.

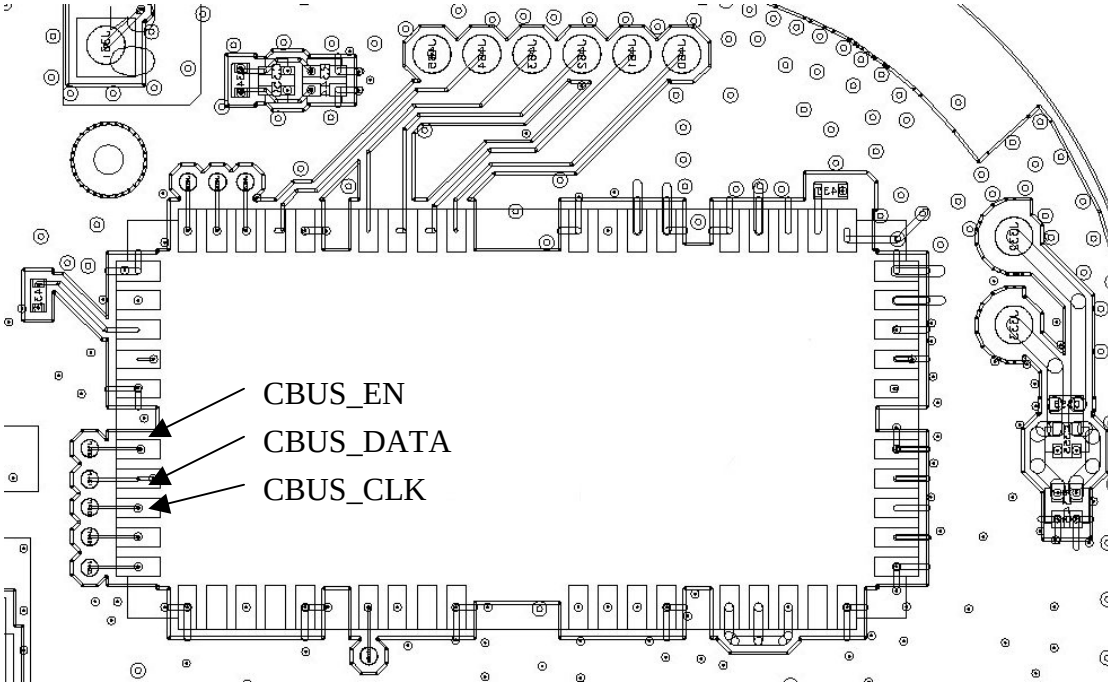

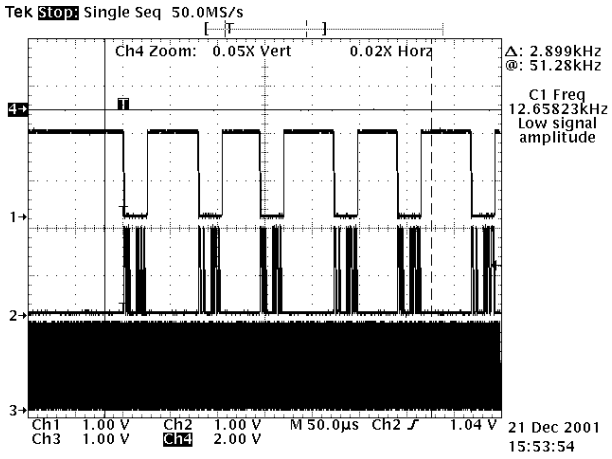

If however you are able to get the phone to boot up and can reach Phoenix BB self tests it is possible to test the functionality of each component attached to Cbus. Use

Copyright © 2004 Nokia Corporation
Company Confidential

ST_ZOCUS_CBUS_IF_TEST to test AEM Cbus interface

ST_UEM_CBUS_IF_TEST to test UEM Cbus interface

ST_LPRF_IF_TEST to test Bluetooth Cbus interface

If an error is found testing any of the above components you should replace the failing component.

FBUS

FBUS is a two wire RX and TX interface between UPP and flash/test interface. The bus goes through UEM which adjusts the voltage levels to suit UPP_WD2. The interface voltage level on the phone flash/test pad pattern is 2.78V and on the UPP WD2 end it is 1.8V. The functionality of this interface should not affect the device boot into NORMAL, LOCAL nor TEST modes. Phoenix tests can be performed through MBUS interface in the case of a failure in FBUS interface. Flashing is not possible if there is a problem in FBUS.

MBUS

MBUS is a two wire RX and TX interface between UPP and UEM. From UEM the interface continues to flash/test interface as a one wire interface. UEM also adjusts the voltage levels. The interface voltage level on the phone flash/test pad pattern is 2.78V and on the UPP WD2 end it is 1.8V. MBUS traffic between UPP WD2 and UEM can be tested with PHOENIX (ST_MBUS_RX_TX_LOOP_TEST). Flashing is not possible if there is a problem in MBUS.

Copyright © 2004 Nokia Corporation
Company Confidential

MMC troubleshooting

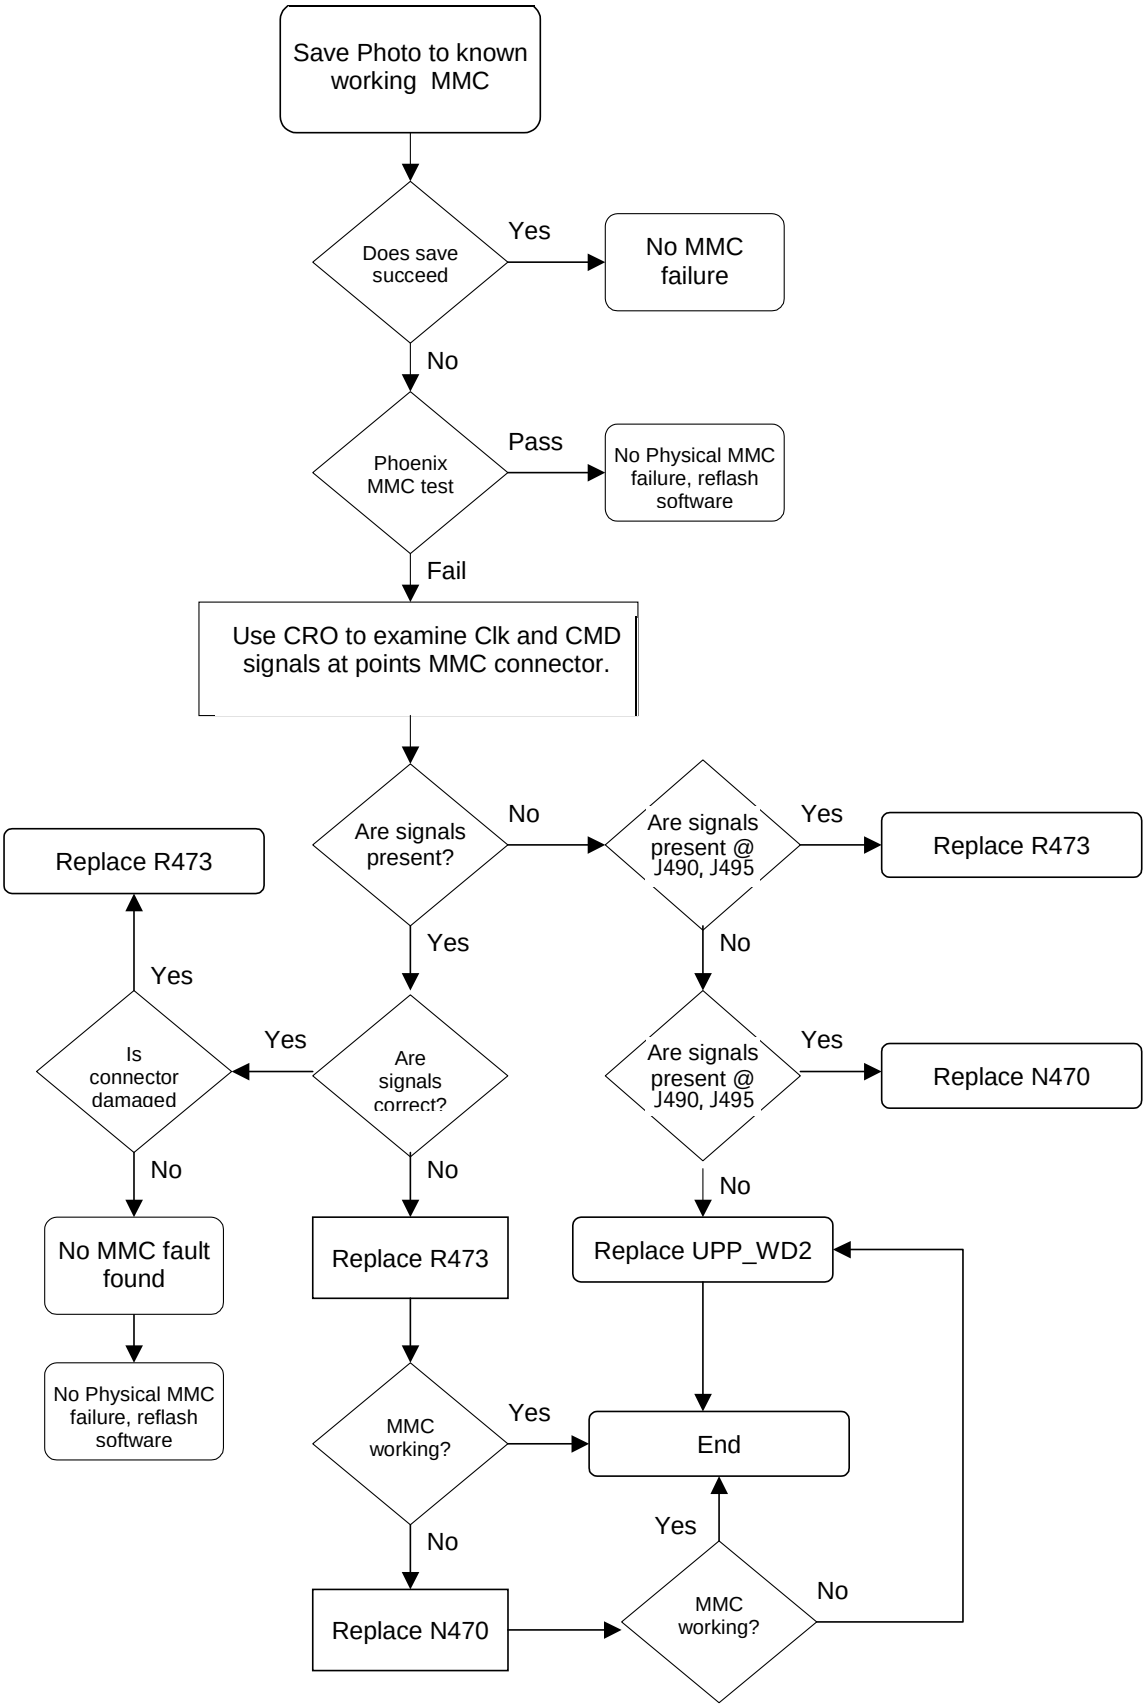

Copyright © 2004 Nokia Corporation
Company Confidential

Vibra

There may be three kinds of problems with the vibra:

- it does not rotate

- It is noisy

- it is continuously on

Noisiness is usually caused by the contact of the rotating mass with surrounding mechanics.

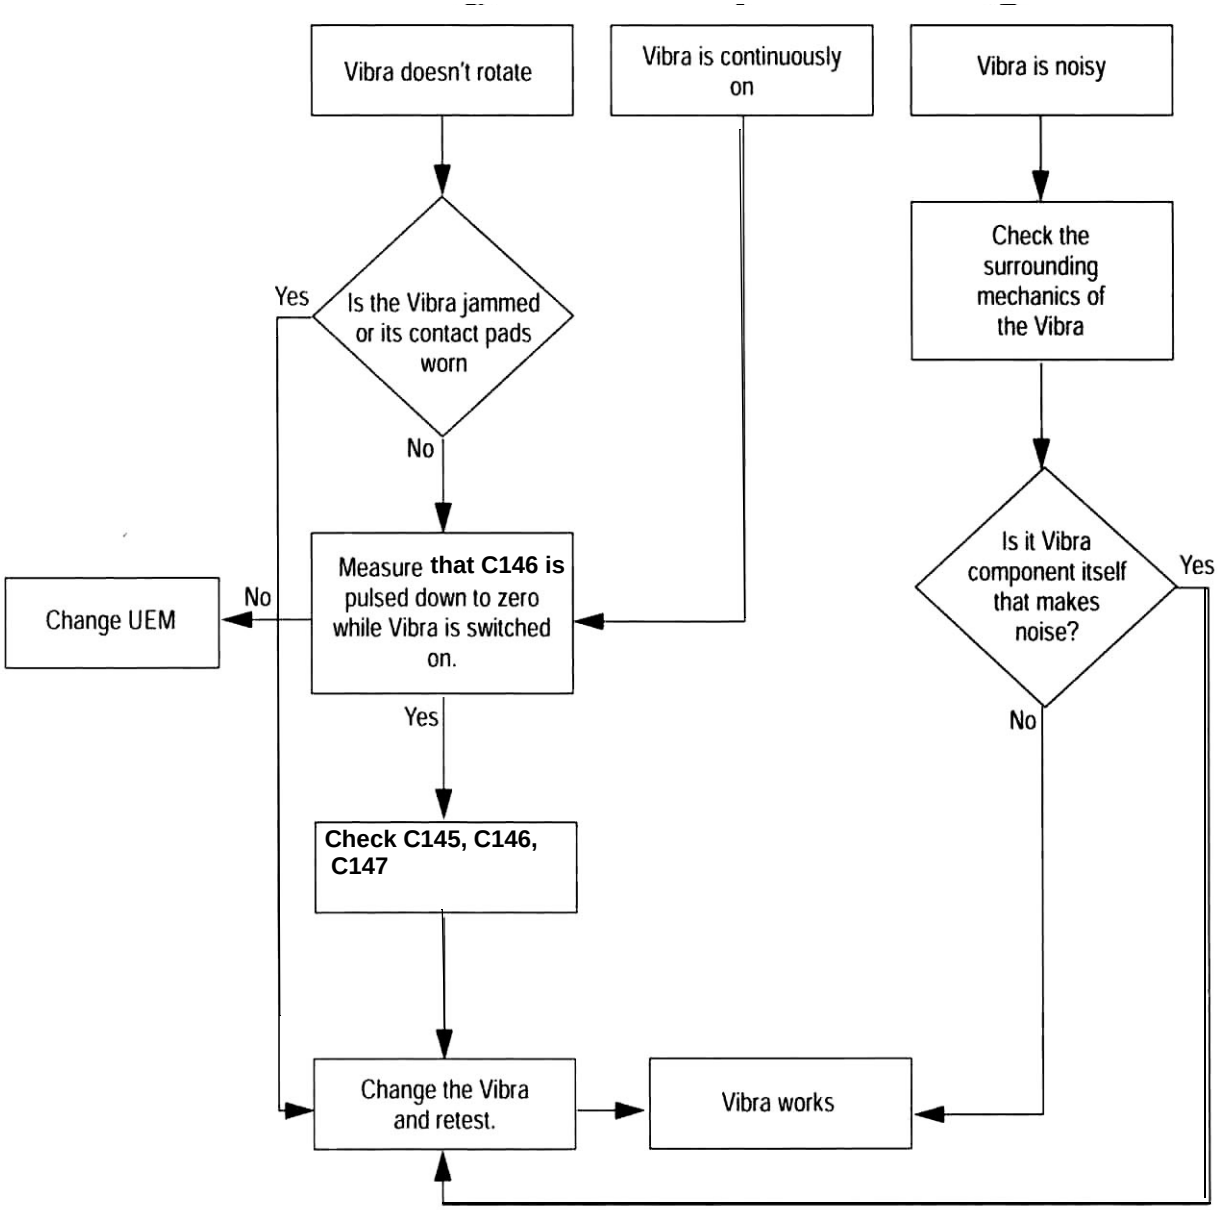

Copyright © 2004 Nokia Corporation
Company Confidential

ZOCUS

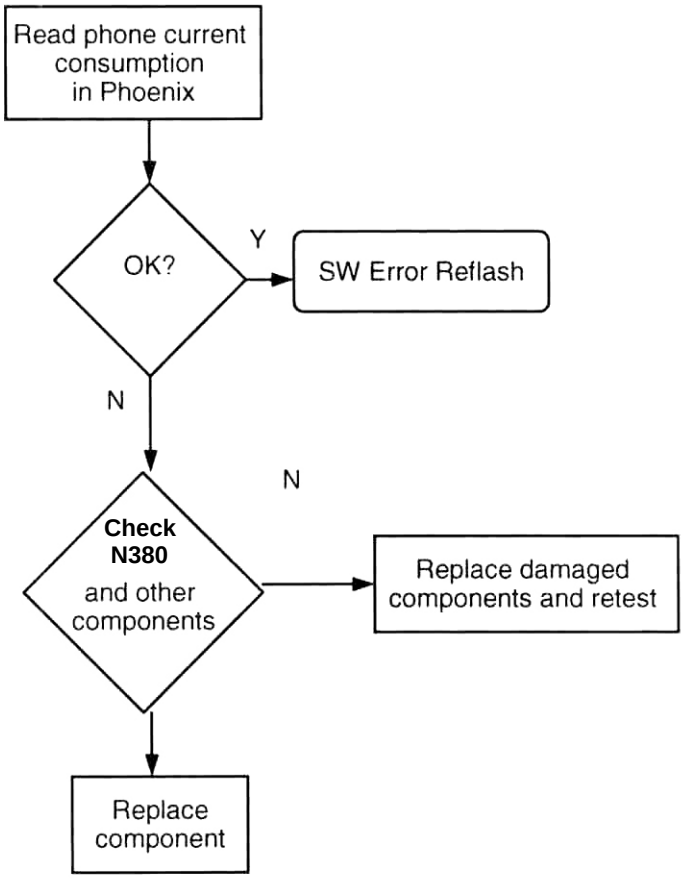

Copyright © 2004 Nokia Corporation
Company Confidential

UI Module Troubleshooting

This document describes the troubleshooting of the UI module

If the problem is in the display or in the keymat PWB the entire UI module must be replaced. However, the earpiece may be replaced (see audio troubleshooting).

Keymat backlight

If the keymat backlight is not functioning and the backlight driver voltage is generated correctly on the 1CK module, then the problem is either in the connector or the UI module. Note that it is possible that one LED is dead while all others are working.

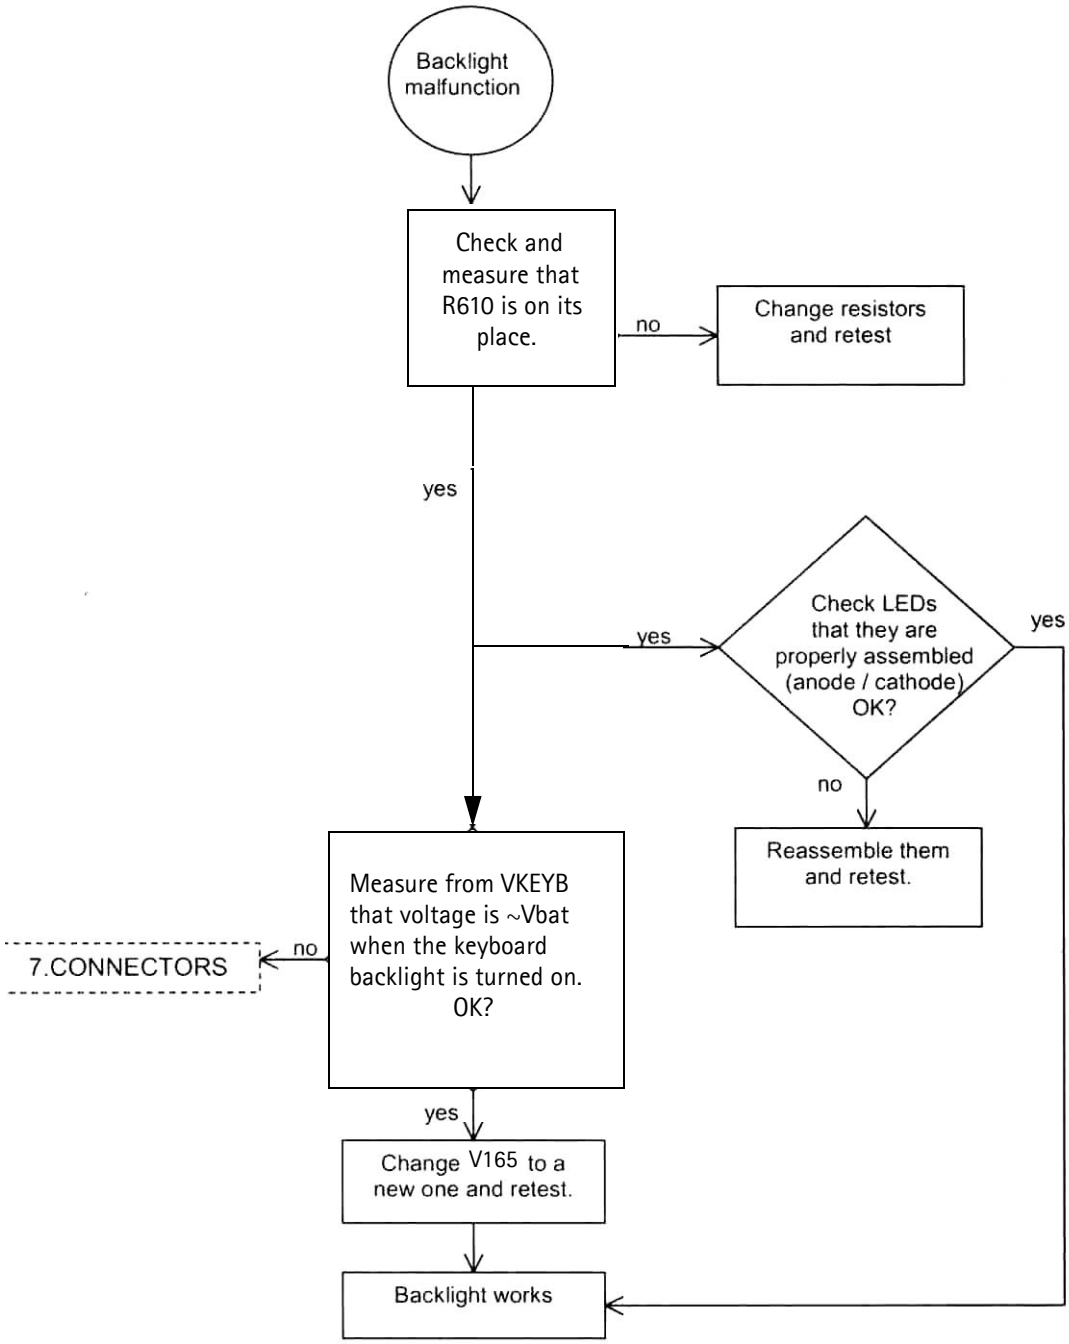

Copyright © 2004 Nokia Corporation
Company Confidential

Keyboard problem

If the keyboard does not work, follow the troubleshooting chart below:

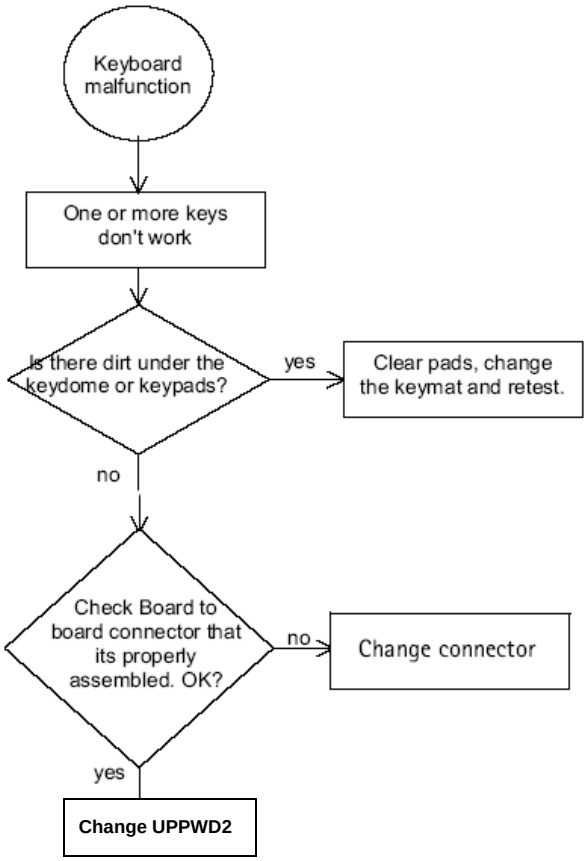

Copyright © 2004 Nokia Corporation
Company Confidential

Display blank

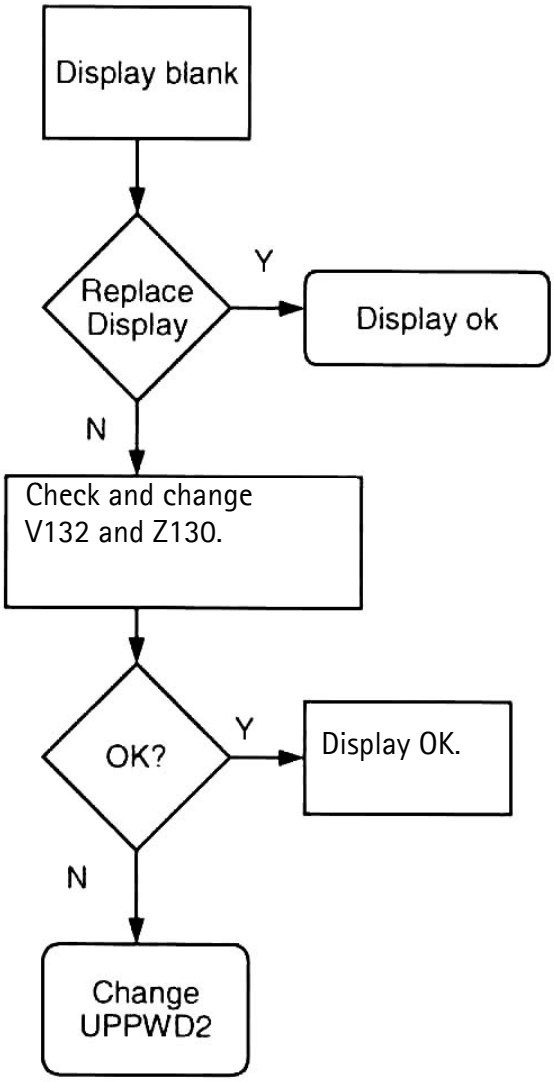

Copyright © 2004 Nokia Corporation
Company Confidential

Image on display not correct

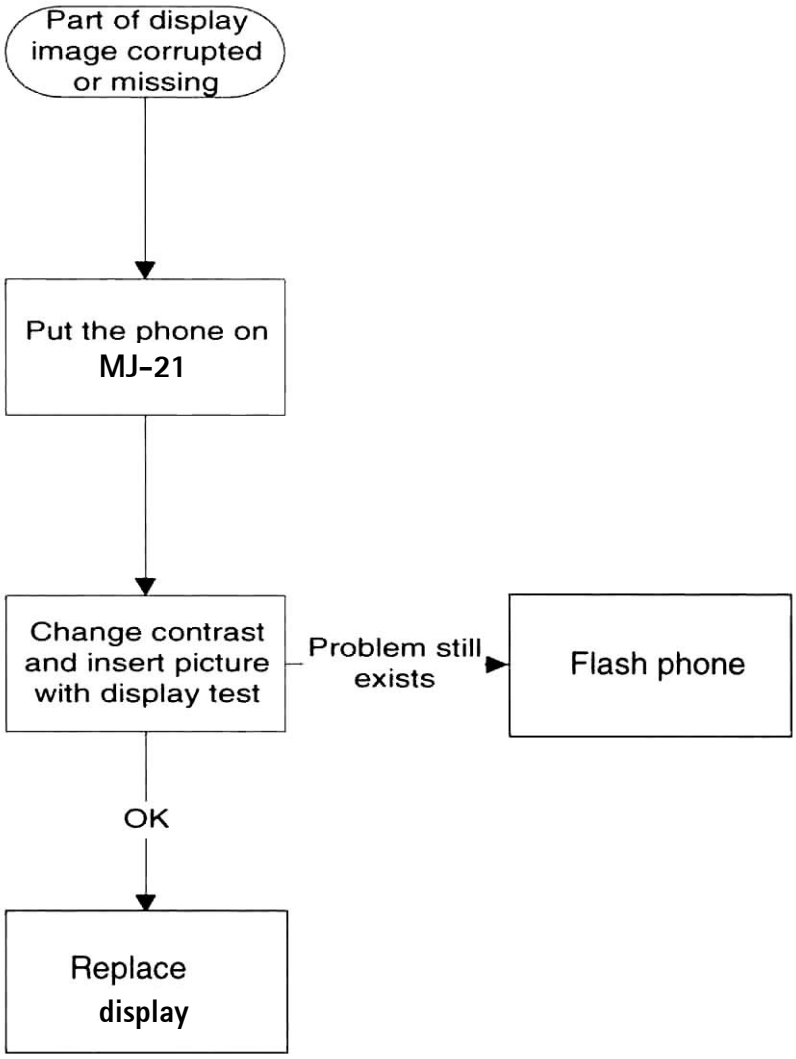
Part of display image corrupted or missing
Put the phone on MJ-21
Change contrast and insert picture with display test
Problem still exists
Flash phone
OK
Replace display

Copyright © 2004 Nokia Corporation
Company Confidential

Display backlight does not turn on

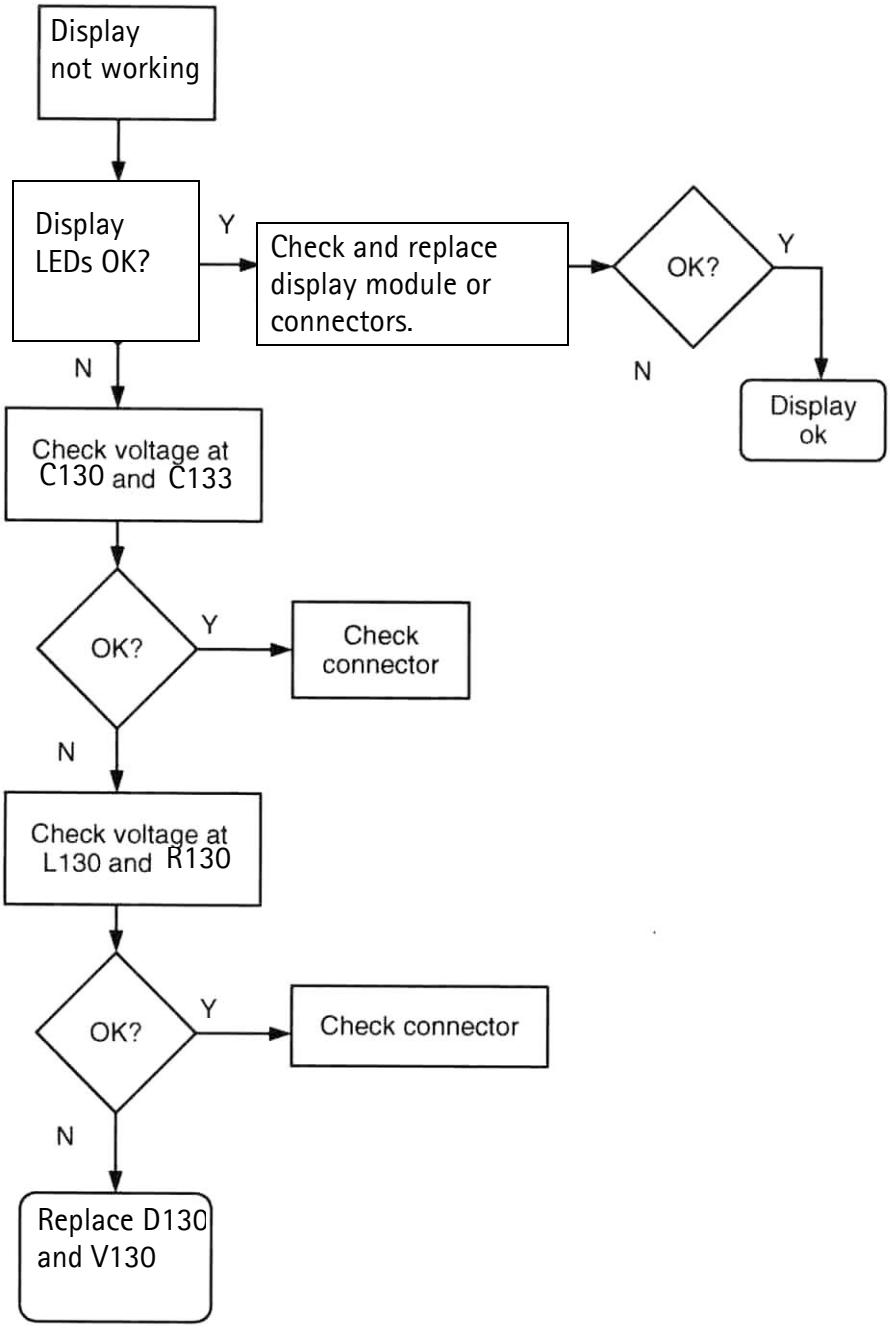

Copyright © 2004 Nokia Corporation
Company Confidential

Hand portable audio

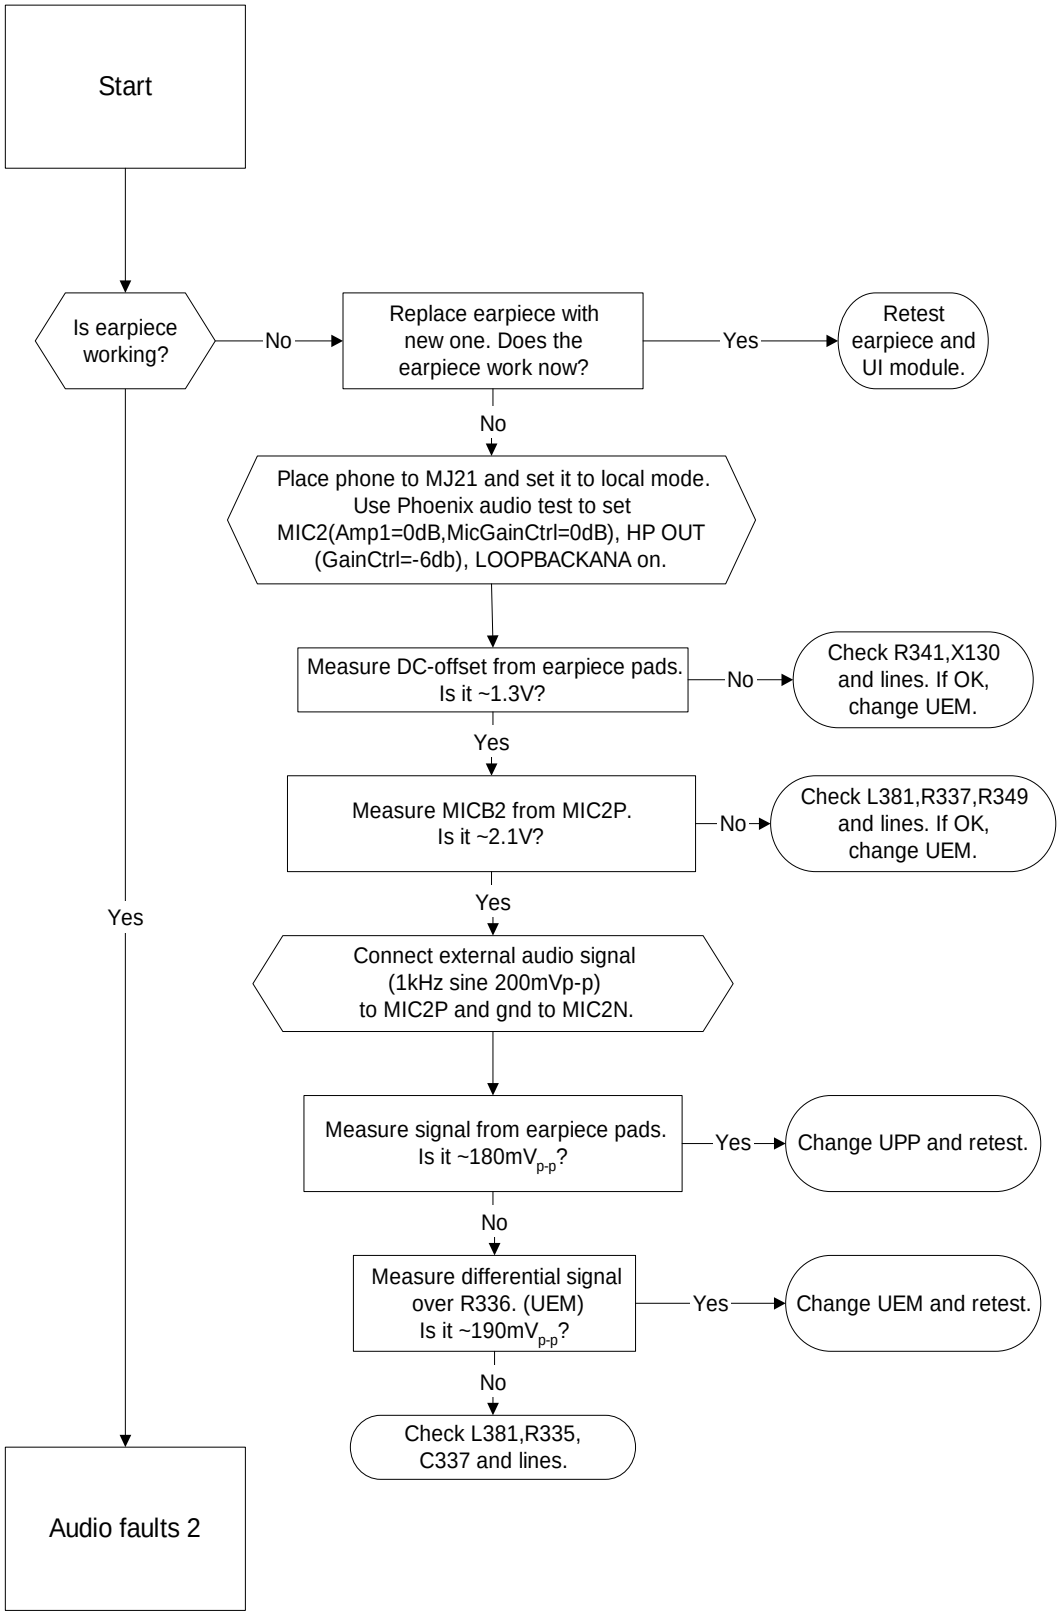
Start
Is earpiece working?
No
Replace earpiece with new one. Does the earpiece work now?
Yes
Retest earpiece and UI module.
No
Place phone to MJ21 and set it to local mode. Use Phoenix audio test to set MIC2(Amp1=0dB,MicGainCtrl=0dB), HP OUT (GainCtrl=-6db), LOOPBACKANA on.
Measure DC-offset from earpiece pads. Is it ~1.3V?
No
Check R341,X130 and lines. If OK, change UEM.
Yes
Measure MICB2 from MIC2P. Is it ~2.1V?
No
Check L381,R337,R349 and lines. If OK, change UEM.
Yes
Yes
Connect external audio signal (1kHz sine 200mVp-p) to MIC2P and gnd to MIC2N.
Measure signal from earpiece pads. Is it ~180mVp-p?
Yes
Change UPP and retest.
No
Measure differential signal over R336. (UEM) Is it ~190mVp-p?
Yes
Change UEM and retest.
No
Check L381,R335, C337 and lines.
Audio faults 2

Copyright © 2004 Nokia Corporation
Company Confidential

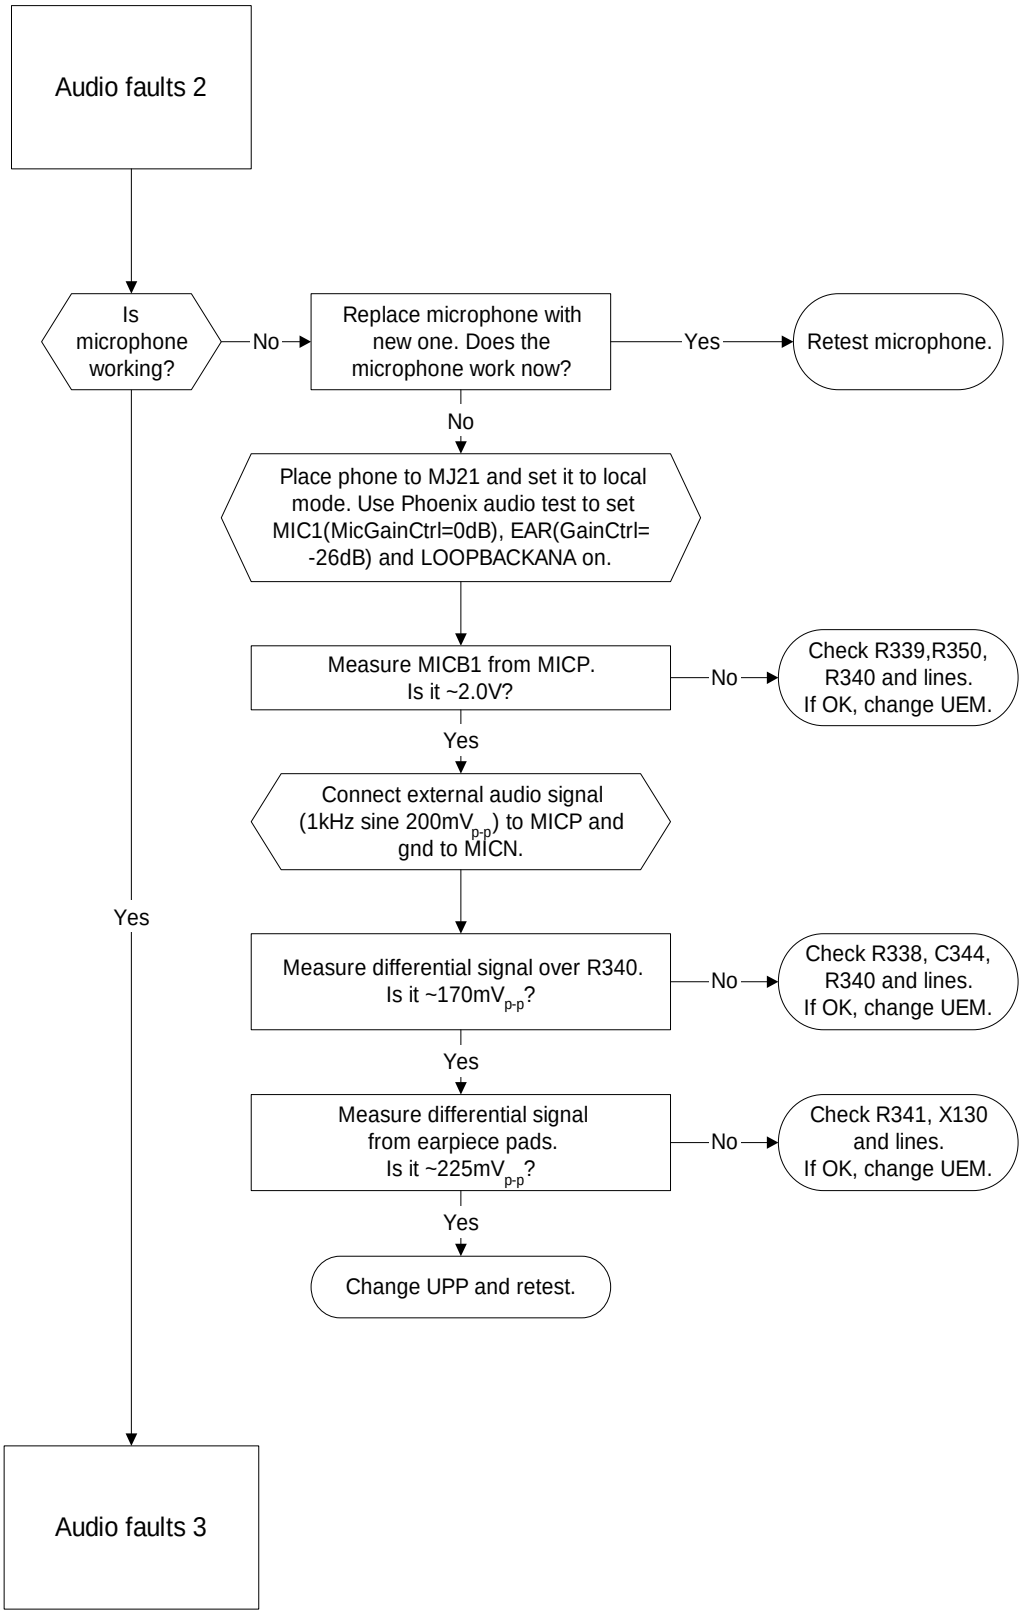
Audio faults 2
Is microphone working?
No
Replace microphone with new one. Does the microphone work now?
Yes
Retest microphone.
No
Place phone to MJ21 and set it to local mode. Use Phoenix audio test to set MIC1(MicGainCtrl=0dB), EAR(GainCtrl= -26dB) and LOOPBACKANA on.
Measure MICB1 from MICP. Is it ~2.0V?
No
Check R339,R350, R340 and lines. If OK, change UEM.
Yes
Connect external audio signal (1kHz sine 200mVp-p) to MICP and gnd to MICN.
Measure differential signal over R340. Is it ~170mVp-p?
No
Check R338, C344, R340 and lines. If OK, change UEM.
Yes
Measure differential signal from earpiece pads. Is it ~225mVp-p?
No
Check R341, X130 and lines. If OK, change UEM.
Yes
Change UPP and retest.
Yes
Audio faults 3

Copyright © 2004 Nokia Corporation
Company Confidential

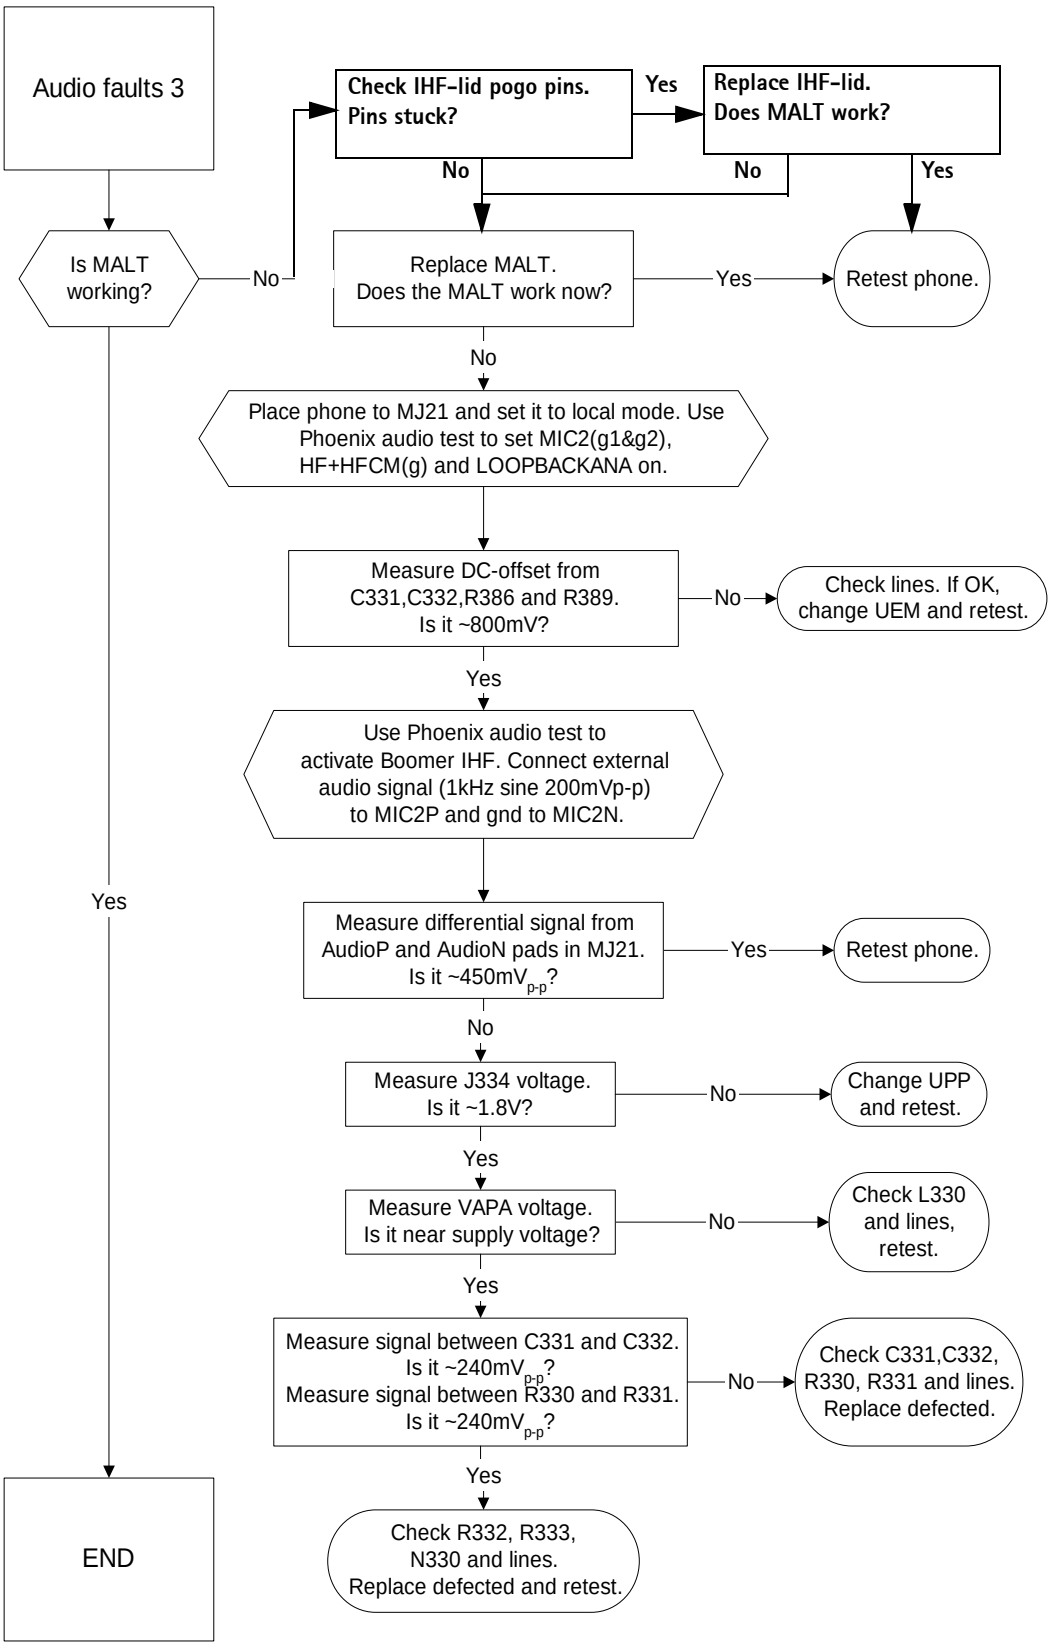
Audio faults 3
Check IHF-lid pogo pins. Pins stuck?
Yes
Replace IHF-lid. Does MALT work?
No
No
Yes
Is MALT working?
No
Replace MALT. Does the MALT work now?
Yes
Retest phone.
No
Place phone to MJ21 and set it to local mode. Use Phoenix audio test to set MIC2(g1&g2), HF+HFCM(g) and LOOPBACKANA on.
Measure DC-offset from C331,C332,R386 and R389. Is it ~800mV?
No
Check lines. If OK, change UEM and retest.
Yes
Use Phoenix audio test to activate Boomer IHF. Connect external audio signal (1kHz sine 200mVp-p) to MIC2P and gnd to MIC2N.
Yes
Measure differential signal from AudioP and AudioN pads in MJ21. Is it ~450mV$_{p-p}$?
Yes
Retest phone.
No
Measure J334 voltage. Is it ~1.8V?
No
Change UPP and retest.
Yes
Measure VAPA voltage. Is it near supply voltage?
No
Check L330 and lines, retest.
Yes
Measure signal between C331 and C332. Is it ~240mV$_{p-p}$? Measure signal between R330 and R331. Is it ~240mV$_{p-p}$?
No
Check C331,C332, R330, R331 and lines. Replace defected.
Yes
Check R332, R333, N330 and lines. Replace defected and retest.
END

Copyright © 2004 Nokia Corporation
Company Confidential

Accessory Audio

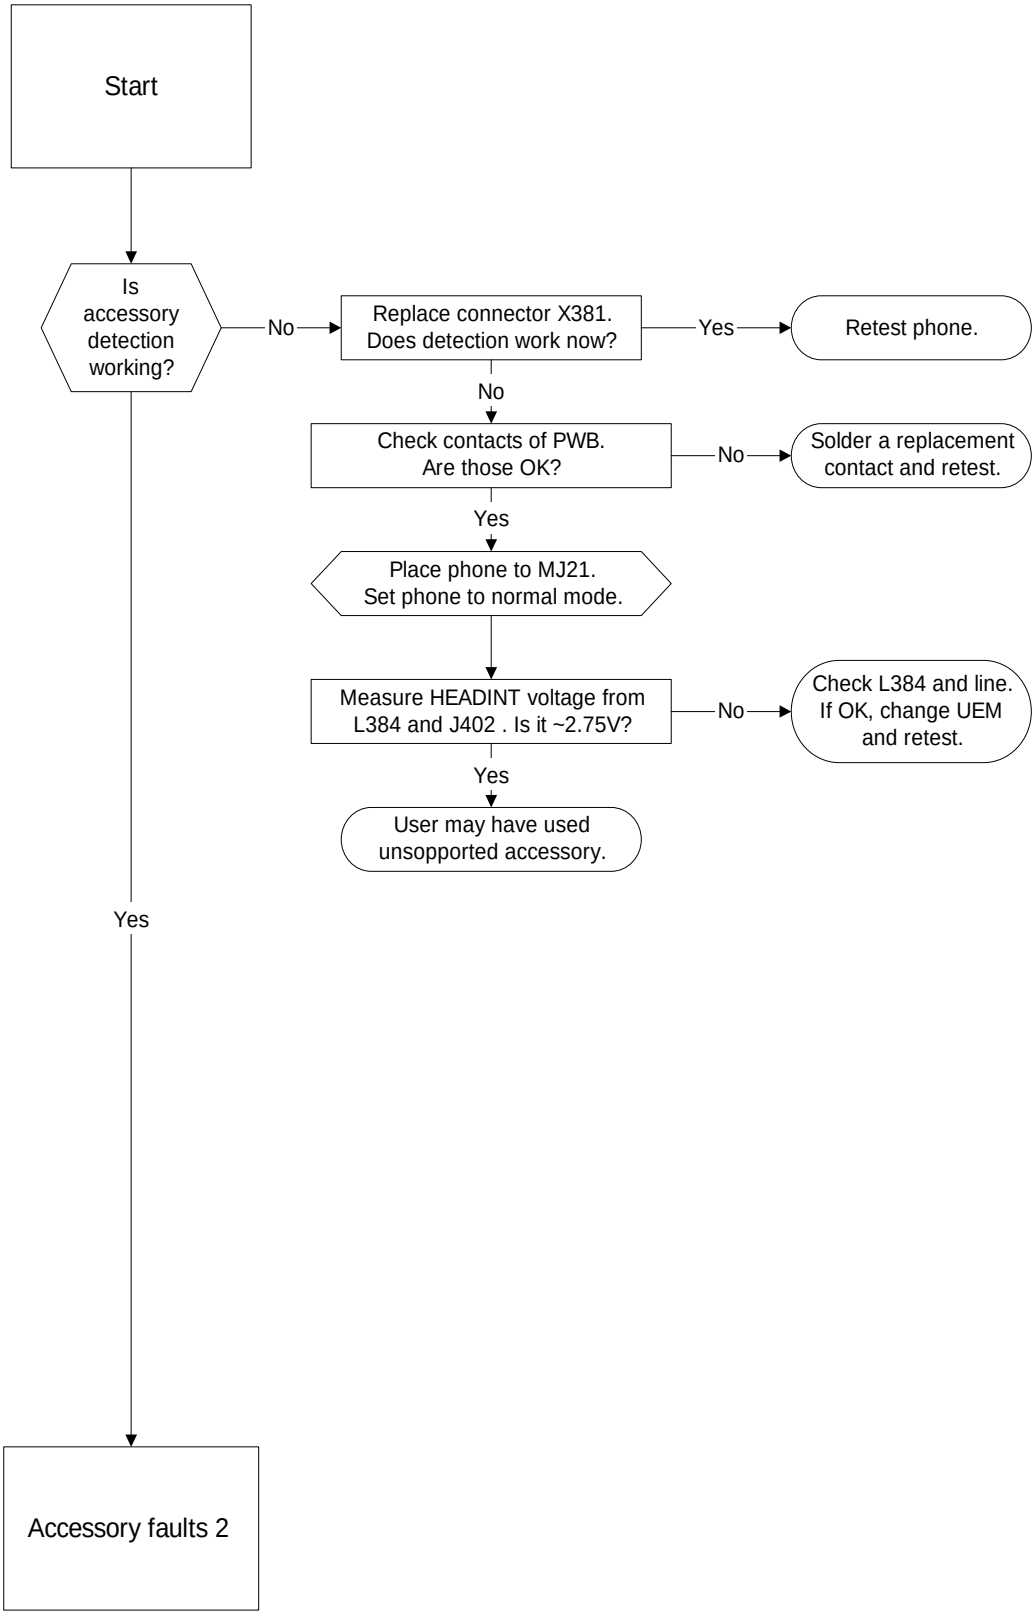

Copyright © 2004 Nokia Corporation
Company Confidential

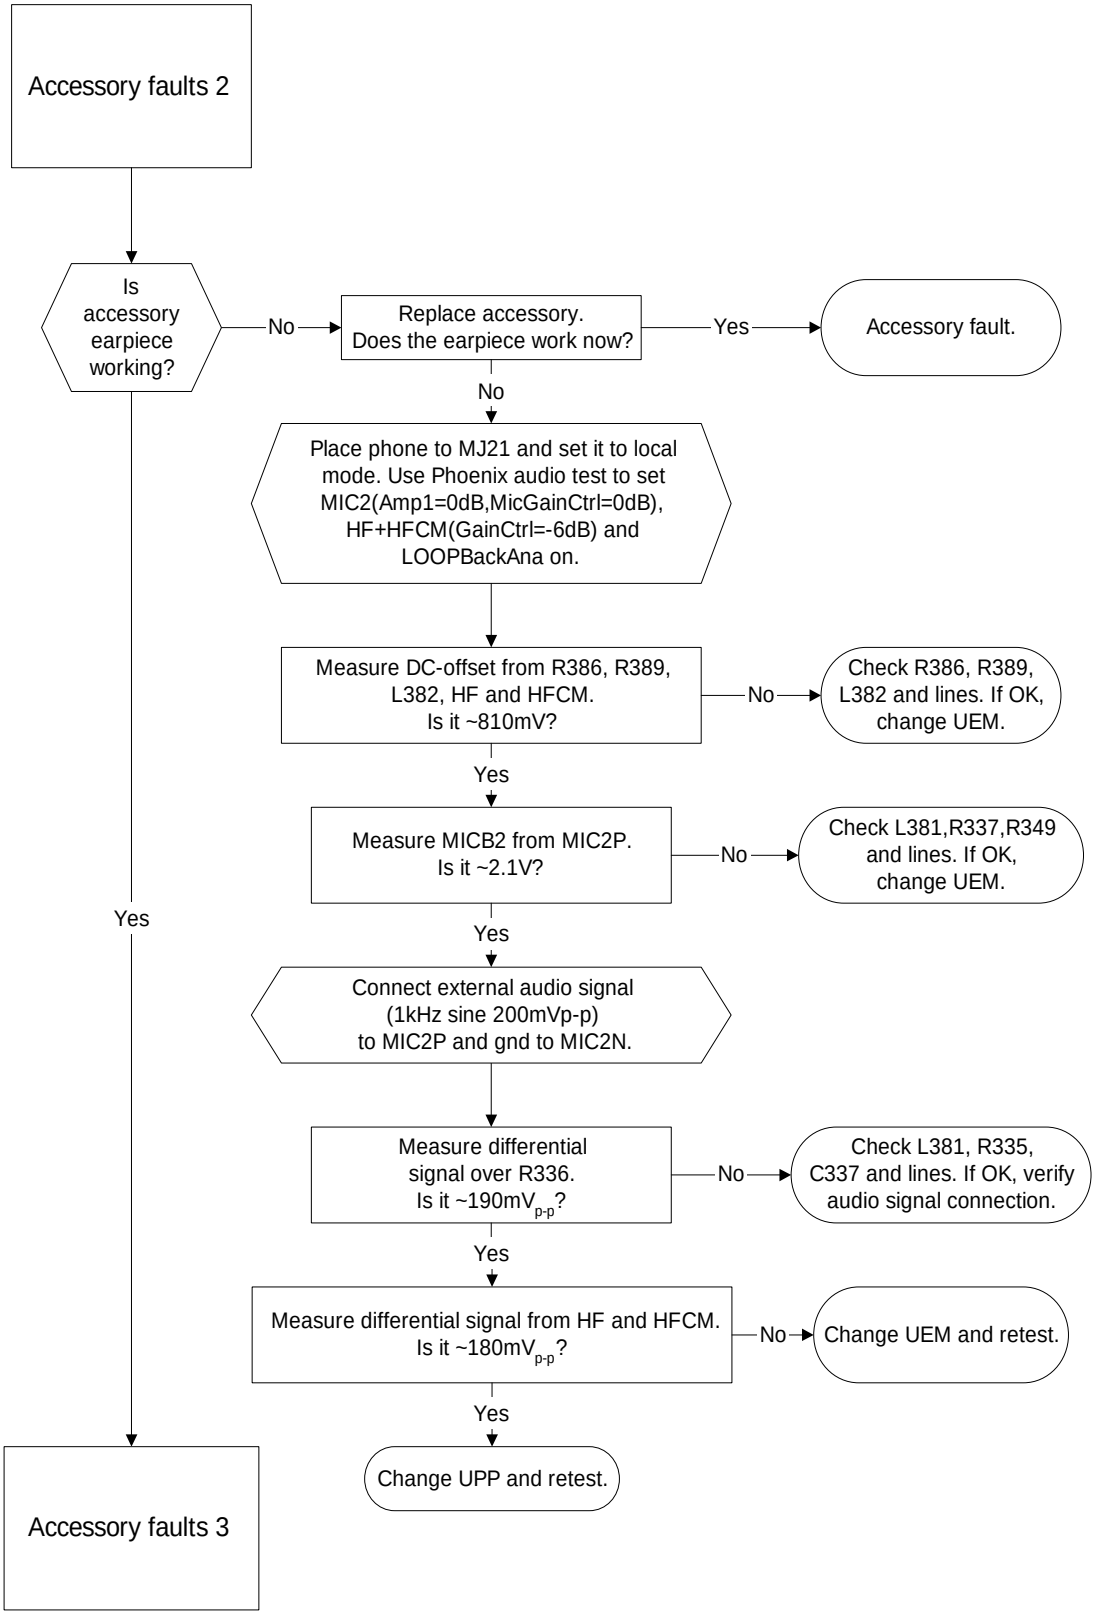
Accessory faults 2
Is accessory earpiece working?
No
Replace accessory. Does the earpiece work now?
Yes
Accessory fault.
No
Place phone to MJ21 and set it to local mode. Use Phoenix audio test to set MIC2(Amp1=0dB,MicGainCtrl=0dB), HF+HFCM(GainCtrl=-6dB) and LOOPBackAna on.
Measure DC-offset from R386, R389, L382, HF and HFCM. Is it ~810mV?
No
Check R386, R389, L382 and lines. If OK, change UEM.
Yes
Measure MICB2 from MIC2P. Is it ~2.1V?
No
Check L381,R337,R349 and lines. If OK, change UEM.
Yes
Yes
Connect external audio signal (1kHz sine 200mVp-p) to MIC2P and gnd to MIC2N.
Measure differential signal over R336. Is it ~190mV$_{p-p}$?
No
Check L381, R335, C337 and lines. If OK, verify audio signal connection.
Yes
Measure differential signal from HF and HFCM. Is it ~180mV$_{p-p}$?
No
Change UEM and retest.
Yes
Change UPP and retest.
Accessory faults 3

Copyright © 2004 Nokia Corporation
Company Confidential

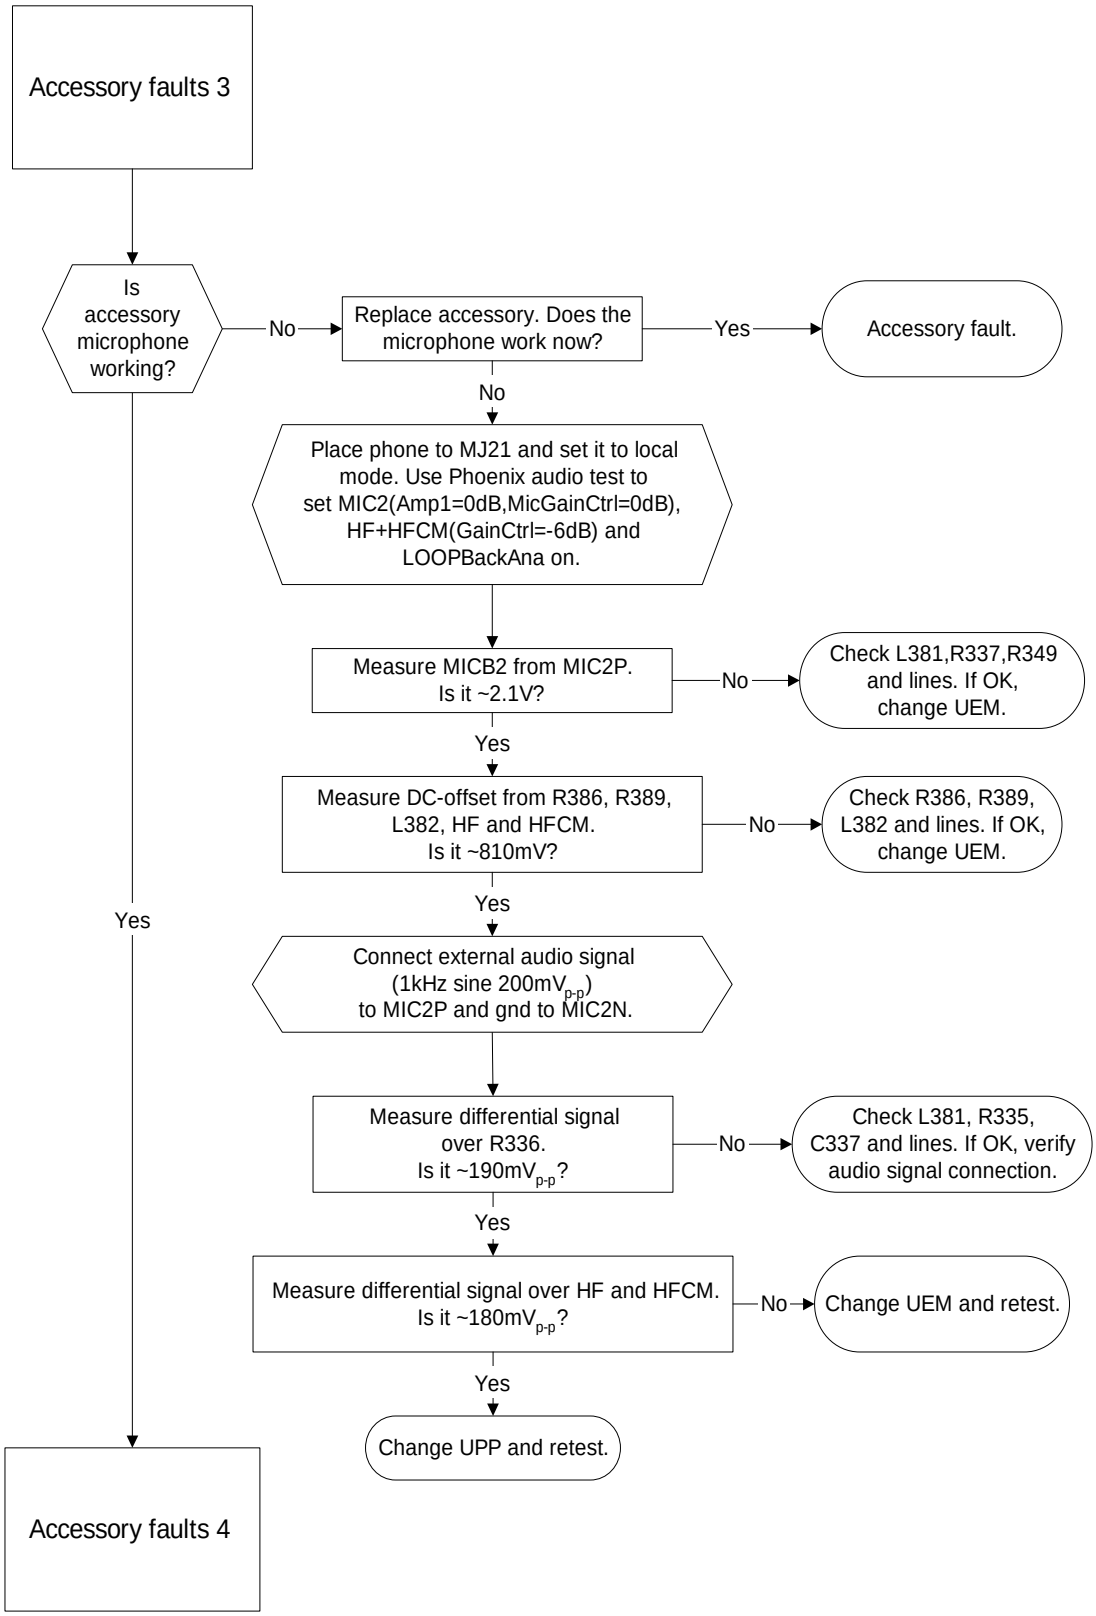
Accessory faults 3
Is accessory microphone working?
No
Replace accessory. Does the microphone work now?
Yes
Accessory fault.
No
Place phone to MJ21 and set it to local mode. Use Phoenix audio test to set MIC2(Amp1=0dB,MicGainCtrl=0dB), HF+HFCM(GainCtrl=-6dB) and LOOPBackAna on.
Measure MICB2 from MIC2P. Is it ~2.1V?
No
Check L381,R337,R349 and lines. If OK, change UEM.
Yes
Measure DC-offset from R386, R389, L382, HF and HFCM. Is it ~810mV?
No
Check R386, R389, L382 and lines. If OK, change UEM.
Yes
Yes
Connect external audio signal (1kHz sine 200mVp-p) to MIC2P and gnd to MIC2N.
Measure differential signal over R336. Is it ~190mVp-p?
No
Check L381, R335, C337 and lines. If OK, verify audio signal connection.
Yes
Measure differential signal over HF and HFCM. Is it ~180mVp-p?
No
Change UEM and retest.
Yes
Change UPP and retest.
Accessory faults 4

Copyright © 2004 Nokia Corporation
Company Confidential

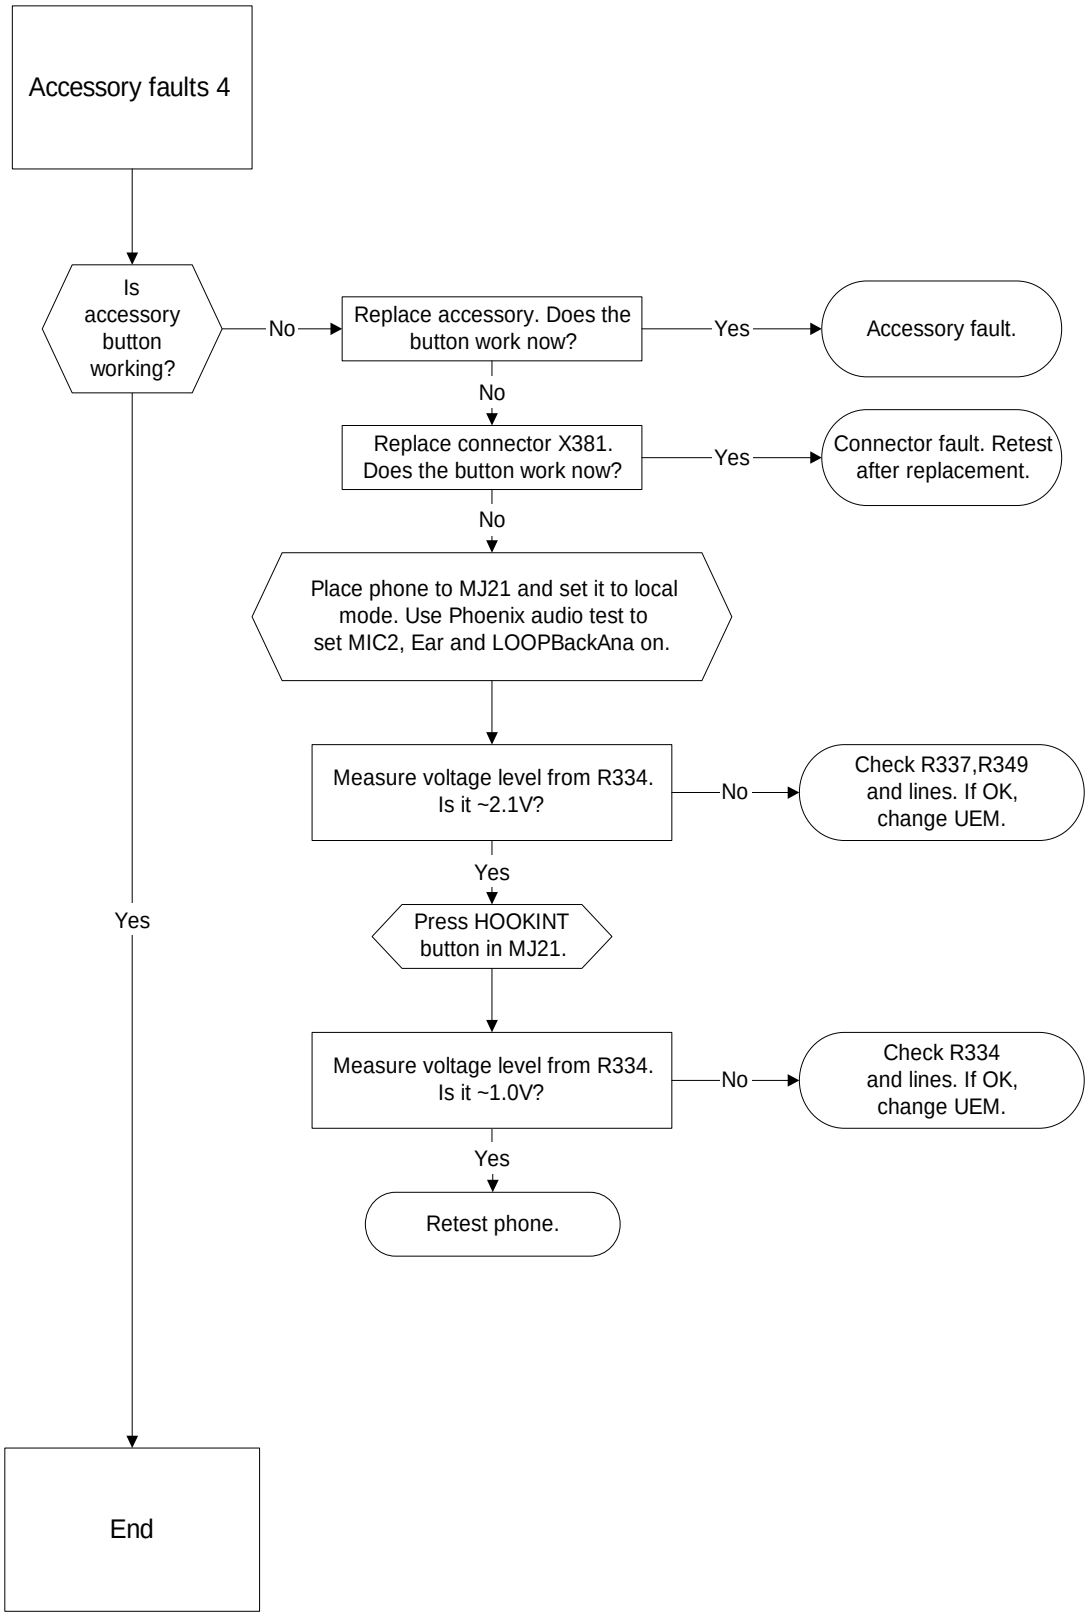
Accessory faults 4
Is accessory button working?
No
Replace accessory. Does the button work now?
Yes
Accessory fault.
No
Replace connector X381. Does the button work now?
Yes
Connector fault. Retest after replacement.
No
Place phone to MJ21 and set it to local mode. Use Phoenix audio test to set MIC2, Ear and LOOPBackAna on.
Measure voltage level from R334. Is it ~2.1V?
No
Check R337,R349 and lines. If OK, change UEM.
Yes
Press HOOKINT button in MJ21.
Measure voltage level from R334. Is it ~1.0V?
No
Check R334 and lines. If OK, change UEM.
Yes
Retest phone.
Yes
End

Copyright © 2004 Nokia Corporation
Company Confidential

射 频 和 天 线 设 计 培 训 课 程 推 荐

易迪拓培训(www.edatop.com)由数名来自于研发第一线的资深工程师发起成立，致力并专注于微波、射频、天线设计研发人才的培养；我们于 2006 年整合合并微波 EDA 网(www.mweda.com)，现已发展成为国内最大的微波射频和天线设计人才培养基地，成功推出多套微波射频以及天线设计经典培训课程和 ADS、HFSS 等专业软件使用培训课程，广受客户好评；并先后与人民邮电出版社、电子工业出版社合作出版了多本专业图书，帮助数万名工程师提升了专业技术能力。客户遍布中兴通讯、研通高频、埃威航电、国人通信等多家国内知名公司，以及台湾工业技术研究院、永业科技、全一电子等多家台湾地区企业。

易迪拓培训课程列表：http://www.edatop.com/peixun/rfe/129.html

射频工程师养成培训课程套装

该套装精选了射频专业基础培训课程、射频仿真设计培训课程和射频电路测量培训课程三个类别共 30 门视频培训课程和 3 本图书教材；旨在引领学员全面学习一个射频工程师需要熟悉、理解和掌握的专业知识和研发设计能力。通过套装的学习，能够让学员完全达到和胜任一个合格的射频工程师的要求…

课程网址：http://www.edatop.com/peixun/rfe/110.html

ADS 学习培训课程套装

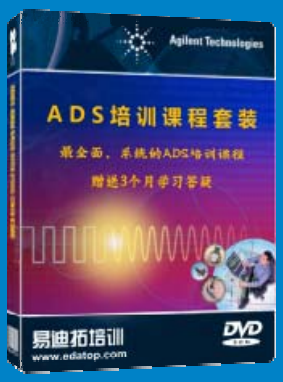

该套装是迄今国内最全面、最权威的 ADS 培训教程，共包含 10 门 ADS 学习培训课程。课程是由具有多年 ADS 使用经验的微波射频与通信系统设计领域资深专家讲解，并多结合设计实例，由浅入深、详细而又全面地讲解了 ADS 在微波射频电路设计、通信系统设计和电磁仿真设计方面的内容。能让您在最短的时间内学会使用 ADS，迅速提升个人技术能力，把 ADS 真正应用到实际研发工作中去，成为 ADS 设计专家...

课程网址： http://www.edatop.com/peixun/ads/13.html

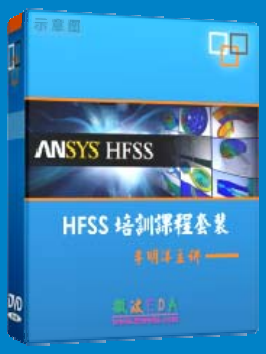

HFSS 学习培训课程套装

该套课程套装包含了本站全部 HFSS 培训课程，是迄今国内最全面、最专业的 HFSS 培训教程套装，可以帮助您从零开始，全面深入学习 HFSS 的各项功能和在多个方面的工程应用。购买套装，更可超值赠送 3 个月免费学习答疑，随时解答您学习过程中遇到的棘手问题，让您的 HFSS 学习更加轻松顺畅…

课程网址：http://www.edatop.com/peixun/hfss/11.html

CST 学习培训课程套装

该培训套装由易迪拓培训联合微波 EDA 网共同推出，是最全面、系统、专业的 CST 微波工作室培训课程套装，所有课程都由经验丰富的专家授课，视频教学，可以帮助您从零开始，全面系统地学习 CST 微波工作的各项功能及其在微波射频、天线设计等领域的设计应用。且购买该套装，还可超值赠送 3 个月免费学习答疑…

课程网址：http://www.edatop.com/peixun/cst/24.html

HFSS 天线设计培训课程套装

套装包含 6 门视频课程和 1 本图书，课程从基础讲起，内容由浅入深，理论介绍和实际操作讲解相结合，全面系统的讲解了 HFSS 天线设计的全过程。是国内最全面、最专业的 HFSS 天线设计课程，可以帮助您快速学习掌握如何使用 HFSS 设计天线，让天线设计不再难…

课程网址：http://www.edatop.com/peixun/hfss/122.html

13.56MHz NFC/RFID 线圈天线设计培训课程套装

套装包含 4 门视频培训课程，培训将 13.56MHz 线圈天线设计原理和仿真设计实践相结合，全面系统地讲解了 13.56MHz 线圈天线的工作原理、设计方法、设计考量以及使用 HFSS 和 CST 仿真分析线圈天线的具体操作，同时还介绍了 13.56MHz 线圈天线匹配电路的设计和调试。通过该套课程的学习，可以帮助您快速学习掌握 13.56MHz 线圈天线及其匹配电路的原理、设计和调试…

详情浏览：http://www.edatop.com/peixun/antenna/116.html

我们的课程优势：

※ 成立于 2004 年，10 多年丰富的行业经验，

※ 一直致力并专注于微波射频和天线设计工程师的培养，更了解该行业对人才的要求

※ 经验丰富的一线资深工程师讲授，结合实际工程案例，直观、实用、易学

联系我们：

※ 易迪拓培训官网：http://www.edatop.com

※ 微波 EDA 网：http://www.mweda.com

※ 官方淘宝店：http://shop36920890.taobao.com